DIVISION OF MAINTENANCE STRUCTURE MAINTENANCE & INVESTIGATIONS 100 South Main Street, 3rd Floor LOS ANGELES, CA 90012 PHONE (213) 897-2004 FAX (213) 897-2033



July 24, 2019

Mr. Marwan Youssef Director Of Public Works/City Engineer City of Westminster 8200 Westminster Blvd Westminster, CA 92683

Dear Mr. Youssef:

In accordance with Title 23 of the Code of Federal Regulations (Federal Highway Act) and the National Bridge Inspection Standards (NBIS), Caltrans Structure Maintenance and Investigations performed an inspection of 5 bridges under your jurisdiction. The type of inspection is indicated on the bridge report transmittal sheet. The bridges have been rated to indicate their deficiencies, structural adequacy, safe load carrying capacity and overall general condition.

Enclosed are copies of the Bridge Inspection Reports for the structures noted on the attached transmittal sheet. These reports contain descriptions of physical changes to the structures since the last inspection, recommendations for work to be done, and additional information not recorded in the previous Bridge Reports.

Your attention is directed to the requirements of Title 23, Part 650 of the Code of Federal Regulations, where newly completed structures or any modification of existing structures shall be entered in the inventory within 90 days. Please notify this office of any newly constructed bridge or culvert within your jurisdiction, more than 20 feet measured along the center of the roadway and carrying public vehicular traffic or over a public roadway, in order that it may be entered in the inventory of bridge structures in compliance with Federal requirements.

Should you have any questions regarding the enclosed Bridge Inspection Reports, please contact Bing Wu @ (213) 897-0874.

Sincerely

CHING CHAO Office Chief

Structure Maintenance & Investigations - (Investigations-South)

Enclosures

DIVISION OF MAINTENANCE STRUCTURE MAINTENANCE & INVESTIGATIONS 100 South Main Street, 3rd Floor LOS ANGELES, CA 90012 PHONE (213) 897-2004 FAX (213) 897-2033



Bridge Report Transmittal Sheet

Batch <u>51286</u>

City of Westminster			Inspection		Outsta	ınding
Bridge #	Bridge Name	Location	Date	Туре	Work	Cost
55C0108	BOLSA CHICA CHANNEL	100' W BOLSA CHICA RD	04/05/2019	Routine	Y	\$
55C0402	ANAHEIM-BARBER CITY CHANNEL	0.2 MI N TRASK AVE	04/05/2019	Routine	Y	\$
55C0545	WESTMINSTER CHANNEL	0.3 MI S WESTMINSTER AVE	04/05/2019	Routine	Y	\$
55C0648	EAST GARDEN GROVE- WINTERSBURG CHANNEL	0.2 MI N/O DREY ROAD	04/05/2019	Routine	N	\$
55C0649	EAST GARDEN GROVE- WINTERSBURG CHANNEL	0.1 M S/O EDINGER	04/05/2019	Routine	N	\$

5 Bridge(s) in this Transmittal

DIVISION OF MAINTENANCE STRUCTURE MAINTENANCE & INVESTIGATIONS 100 South Main Street, 3rd Floor LOS ANGELES, CA 90012 PHONE (213) 897-2004 FAX (213) 897-2033



WEB SITES:

The National Bridge Inspection Standards (NBIS) Recording and Coding Guide for the Structure Inventory and Appraisal of the Nation's Bridges, Element Level Inspection, Structure Maintenance and Investigations Manuals, Local Assistance Program Guidelines and other related information are posted on Division of Maintenance, Structure Maintenance and Investigations; Division of Local Assistance, Local Highway Bridge Program (HBP) and FHWA websites.

The websites can be accessed at:

- 1. "Caltrans Structure Maintenance and Investigations" http://www.dot.ca.gov/hq/structur/strmaint/
- 2. "Caltrans Division of Local Assistance"

http/www.dot.ca.gov/hq/LocalPrograms/hbrr99/hbrr99a.htm

3. "FHWA" http/www.fhwa.dot.gov/BRIDGE/mtguide.pdf

Inspection Type Definitions

Routine Inspection:

Routine Inspections consist of both the initial Inventory Inspection (the first inspection of the bridge that places it in the bridge inventory or when there has been a change in the configuration of the structure) and subsequent regularly scheduled inspections. The initial inspection provides all the Structural Inventory & Appraisal (SI&A) data required by federal and state regulations, determines the baseline structural conditions, lists any existing problems, and establishes the load capacity of the structure. Subsequent inspections consist of observations, measurements needed to determine the physical and functional condition of the bridge, to identify any changes from the previously recorded conditions, and verification of its load capacity. These inspections are generally conducted from the deck, ground and/or water level, and from permanent work platforms and walkways, if present. Inspection of underwater portions of the substructure is limited to observations during low-flow periods and/or probing for signs of undermining. Special equipment should be utilized in circumstances where its use provides the only practical access to areas of the structure.

Fracture Critical, Special Feature & Underwater Inspections:

Fracture Critical, Special Feature, and Underwater Inspections are up close, hands-on inspections of one or more members above or below the water level to identify any deficiencies not readily detectable using Routine Inspection procedures. These inspections generally require special equipment such as under-bridge inspection equipment, manlifts, boats, traffic control, and railroad flagging. Personnel with special skills such as divers or structural steel inspectors trained in non-destructive testing techniques may be required.

Other Inspections:

Other Inspections are conducted on damaged structures, structures that have developed specific problems, or structures suspected of developing problems. The scope of these investigations should be sufficient to determine the need for emergency load restrictions or closure of the structure, monitor a changing condition, and to assess the level of effort necessary to effect a repair.



Structure Maintenance & Investigations

Bridge Number : 55C0402

Facility Carried: EDWARDS ST

Location : 0.2 MI N TRASK AVE

: WESTMINSTER City Inspection Date: 04/05/2019

Inspection Type

Bridge Inspection Report

Routine FC Underwater Special Other X

STRUCTURE NAME: ANAHEIM-BARBER CITY CHANNEL

CONSTRUCTION INFORMATION

Year Built : 1975 Year Modified: N/A Length (m) : 19.2 Skew (degrees): 36 No. of Joints : 0

No. of Hinges :

Structure Description: Triple (16.0 feet W x 10.5 feet H x 143.0 feet L) RC box culvert

(grade top) beneath 1.0 foot of earth fill.

Span Configuration : (S) 3 @ 16.0 feet (N).

SAFE LOAD CAPACITY AND RATINGS

Design Live Load: UNKNOWN

Inventory Rating: RF=1.00 =>32.4 metric tons Operating Rating: RF=1.67 =>54.1 metric tons Calculation Method: FIELD EVAL/ENG JUDGMENT Calculation Method: FIELD EVAL/ENG JUDGMENT

: PPPPP Permit Rating

Posting Load : Type 3: Legal

Type 3S2:Legal

Type 3-3:Legal

DESCRIPTION ON STRUCTURE

Deck X-Section: (W) 0.65 feet br, 8.0 feet sw, 62.0 feet, 8.0 feet sw, 0.65 feet br (E)

Total Width: 24 3 m Net Width: 18.9 m No. of Lanes: Speed:

35 mph

Min. Vertical Clearance: Unimpaired

Overlay Thickness: 2.0 inches

Rail Code: 0000

DESCRIPTION UNDER STRUCTURE

Channel Description: RC rectangular.

NOTICE

The bridge inspection condition assessment used for this inspection is based on the American Association of State Highway and Transportation Officials (AASHTO) Bridge Element Inspection Manual 2013 as defined in Moving Ahead for Progress in the 21st Century (MAP-21) federal law. new element inspection methodology may result in changes to related condition and appraisal ratings on the bridge without significant physical changes at the bridge.

The element condition information contained in this report represents the current condition of the bridge based on the most recent routine and special inspections. Some of the notes presented below may be from an inspection that occurred prior to the date noted in this report. Refer to the Scope and Access section of this inspection report for a description of which portions of the bridge were inspected on this date.

INSPECTION COMMENTARY

SCOPE AND ACCESS

A complete routine inspection was performed by walking on and around the channel to inspect all visible elements of the structure. Culvert deck was inspected by walking on sidewalks. Soffit and all substructure were inspected by walking underneath the culvert boxes with rain boots due to water at 3.0 inches deep inside barrel #2 at the time of inspection.

There is no need for a special equipment to inspect this structure. Rain boots maybe needed if it is in raining season.

There is an access to underneath the culvert on Garden Grove Blvd approximately 500.0

INSPECTION COMMENTARY

feet west of Golden West Blvd, facing Garden Grove/Golden West Blvd Off-Ramp from 22 Freeway.

REVISIONS

Because the culvert is grade top so some NBI were changed as follows:

NBI #107 was modified from N.A. to 1.

NBI #108A was modified from N.A. to 6.

NBI #108B was modified from N.A.to 0.

NBI #108C was modified from N.A.to 0.

CULVERT

There are longitudinal and transverse cracks 0.05 inches wide throughout the entire AC surface.

SAFE LOAD CAPACITY

The current rating has been assigned in accordance with SMI procedures for culverts. An updated Load Rating Summary is archived on 09/20/2018. Based on the field conditions and load history, the culvert is adequate to carry legal loads.

No. /Prot		Env	Total Qty	Units	-	each Co St. 2		
241	Culvert-RC	2	44	m	44	0	0	0
510	Deck Wearing Surface-Asphalt	2	363	sq.m	340	23	0	0
	3220 Cracking-AC (WS)	2	23		0	23	0	0
There were n	o significant defects noted.							
(241-510) There are lo	ngitudinal and transverse cracks througho					tire AC	surface	· · · · · · · · · · · · · · · · · · ·
(241-510) There are lo	ngitudinal and transverse cracks througho					tire AC	surface	0
(241-510) There are lo (241-510-322 There are lo	ngitudinal and transverse cracks througho 0) ngitudinal and transverse cracks 0.05 inc	thes wid	le thro	ughout	the en			

WORK RECOMMENDATIONS

RecDate: 04/29/2015 EstCost: The City should provide the ABME a

Action: Provide Inspection A StrTarget: 2 YEARS permanent access in which to perform a

Work By: LOCAL AGENCY DistTarget: full inspection underneath the bridge.

Status : PROPOSED EA:

Team Leader : Edwin Mah

Report Author : Nelson N. Vo

Inspected By : E.Mah/NN.Vo

Edwin Mah (Registered Civil Engineer) (Date)



STRUCTURE INVENTORY AND APPRAISAL REPORT

(7)	**************************************		**************************************
	STRUCTURE NUMBER 55C0402		PAINT CONDITION INDEX = N/A
	INVENTORY ROUTE (ON/UNDER) - ON 150000000		
	HIGHWAY AGENCY DISTRICT 12		the the the the the the the terms of the ter
	COUNTY CODE 059 (4) PLACE CODE 84550		********* CLASSIFICATION ********* CODE
	FEATURE INTERSECTED- ANAHEIM-BARBER CITY CHA		NBIS BRIDGE LENGTH- YES Y
	FACILITY CARRIED- EDWARDS ST		HIGHWAY SYSTEM- NOT ON NHS
(9)	LOCATION- 0.2 MI N TRASK AVE		FUNCTIONAL CLASS- MINOR ARTERIAL URBAN 16
(11)	MILEPOINT/KILOMETERPOINT 0		DEFENSE HIGHWAY- NOT STRAHNET 0
(12)	BASE HIGHWAY NETWORK- NOT ON NET 0	(101)	PARALLEL STRUCTURE- NONE EXISTS N
(13)	LRS INVENTORY ROUTE & SUBROUTE	(102)	DIRECTION OF TRAFFIC- 2 WAY 2
(16)	LATITUDE 33 DEG 46 MIN 07.23 SEC	(103)	TEMPORARY STRUCTURE-
(17)	LONGITUDE 118 DEG 00 MIN 56.78 SEC	(105)	FED.LANDS HWY- NOT APPLICABLE 0
(98)	BORDER BRIDGE STATE CODE % SHARE %	(110)	DESIGNATED NATIONAL NETWORK - NOT ON NET 0
(99)	BORDER BRIDGE STRUCTURE NUMBER	(20)	TOLL- ON FREE ROAD 3
		(21)	MAINTAIN- CITY OR MUNICIPAL HIGHWAY AGENCY 04
,	****** STRUCTURE TYPE AND MATERIAL *******	(22)	OWNER- CITY OR MUNICIPAL HIGHWAY AGENCY 04
(43)	STRUCTURE TYPE MAIN: MATERIAL- CONCRETE	(37)	HISTORICAL SIGNIFICANCE- NOT ELIGIBLE 5
	TYPE- CULVERT CODE 119		detailed and the best to be desired as a second of the sec
(44)	STRUCTURE TYPE APPR:MATERIAL- OTHER/NA TYPE- OTHER/NA CODE 000		**************************************
(45)			DECK N SUPERSTRUCTURE N
		(60)	
(46)	NUMBER OF APPROACH SPANS 0		SUBSTRUCTURE N
(107)	DECK STRUCTURE TYPE- CIP CONCRETE CODE 1		CHANNEL & CHANNEL PROTECTION 9
(108)	WEARING SURFACE / PROTECTIVE SYSTEM:	(62)	CULVERTS 7
A)	TYPE OF WEARING SURFACE- BITUMINOUS CODE 6		****** LOAD RATING AND POSTING ****** CODE
B)	TYPE OF MEMBRANE - NONE CODE 0	(31)	DESIGN LOAD- UNKNOWN 0
C)	TYPE OF DECK PROTECTION- NONE CODE 0	=	OPERATING RATING METHOD- FIELD EVAL/ENG JUD 0
	******* AGE AND SERVICE **********		OPERATING RATING- 54.1
(27)	YEAR BUILT 1975		INVENTORY RATING METHOD- FIELD EVAL/ENG JUL 0
	YEAR RECONSTRUCTED 0000		
(42)	TYPE OF SERVICE: ON- HIGHWAY-PEDESTRIAN 5		INVENTORY RATING- 32.4 BRIDGE POSTING- EQUAL TO OR ABOVE LEGAL LOADS 5
	UNDER- WATERWAY 5		STRUCTURE OPEN, POSTED OR CLOSED- A
(28)	LANES: ON STRUCTURE 04 UNDER STRUCTURE 00	(22)	DESCRIPTION- OPEN, NO RESTRICTION
(29)	AVERAGE DAILY TRAFFIC 9500		DESCRIPTION OF ANY, NO RESTRICTION
(30)	YEAR OF ADT 2019 (109) TRUCK ADT 1 %		********** APPRAISAL ********** CODE
(19)	BYPASS, DETOUR LENGTH 2 KM	(67)	STRUCTURAL EVALUATION 7
	************ GEOMETRIC DATA **********	(68)	DECK GEOMETRY 6
(48)	LENGTH OF MAXIMUM SPAN 6.1 M	(69)	UNDERCLEARANCES, VERTICAL & HORIZONTAL N
	STRUCTURE LENGTH 19.2 M	(71)	WATER ADEQUACY 9
	CURB OR SIDEWALK: LEFT 2.1 M RIGHT 2.5 M	(72)	APPROACH ROADWAY ALIGNMENT 8
	BRIDGE ROADWAY WIDTH CURB TO CURB 18.9 M	(36)	TRAFFIC SAFETY FEATURES 0000
	DECK WIDTH OUT TO OUT 24.3 M	(113)	SCOUR CRITICAL BRIDGES 8
			****** PROPOSED IMPROVEMENTS *******
	APPROACH ROADWAY WIDTH (W/SHOULDERS) 18.9 M BRIDGE MEDIAN- NO MEDIAN 0		
	SKEW 36 DEG (35) STRUCTURE FLARED NO		TYPE OF WORK- CODE
	` '		LENGTH OF STRUCTURE IMPROVEMENT M
	INVENTORY ROUTE MIN VERT CLEAR 99.99 M		BRIDGE IMPROVEMENT COST
	INVENTORY ROUTE TOTAL HORIZ CLEAR 18.9 M MIN VERT CLEAR OVER BRIDGE RDWY 99.99 M	(95)	ROADWAY IMPROVEMENT COST
		(96)	TOTAL PROJECT COST
	· · · · · · · · · · · · · · · · · · ·	(97)	YEAR OF IMPROVEMENT COST ESTIMATE
		(114)	FUTURE ADT 10618
		(115)	YEAR OF FUTURE ADT 2037
	*********** NAVIGATION DATA *********		**************************************
	NAVIGATION CONTROL- NOT APPLICABLE CODE N	(90)	INSPECTION DATE 04/19 (91) FREQUENCY 48 MO
	PIER PROTECTION- CODE		CRITICAL FEATURE INSPECTION: (93) CFI DATE
	NAVIGATION VERTICAL CLEARANCE 0.0 M	_	FRACTURE CRIT DETAIL- NO MO A)
	VERT-LIFT BRIDGE NAV MIN VERT CLEAR M		UNDERWATER INSP- NO MO B)
(40)	NAVIGATION HORIZONTAL CLEARANCE 0.0 M		OTHER SPECIAL INSP- NO MO C)

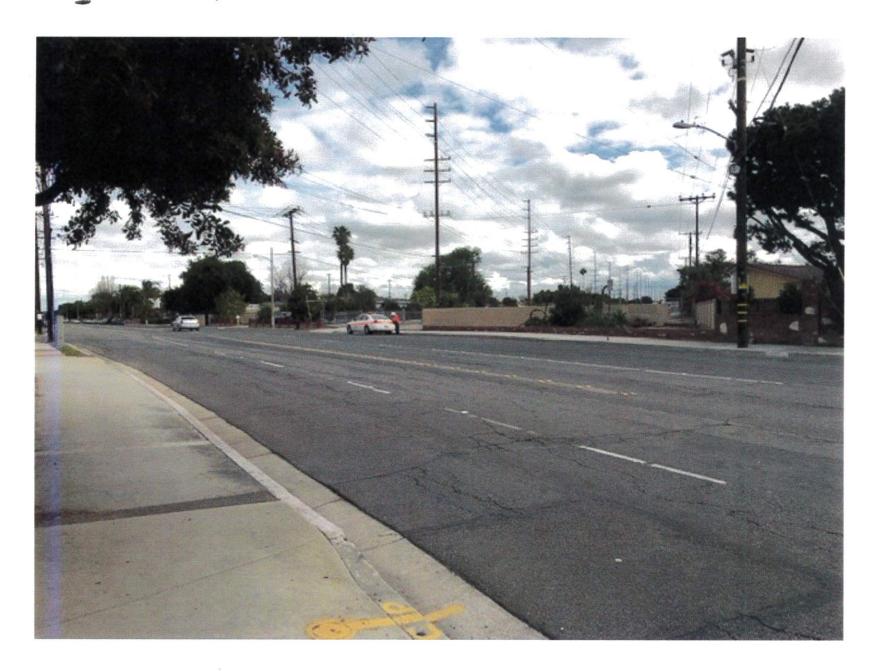


Photo No. 1 Deckview looking north



Photo No. 1 Elevation looking west

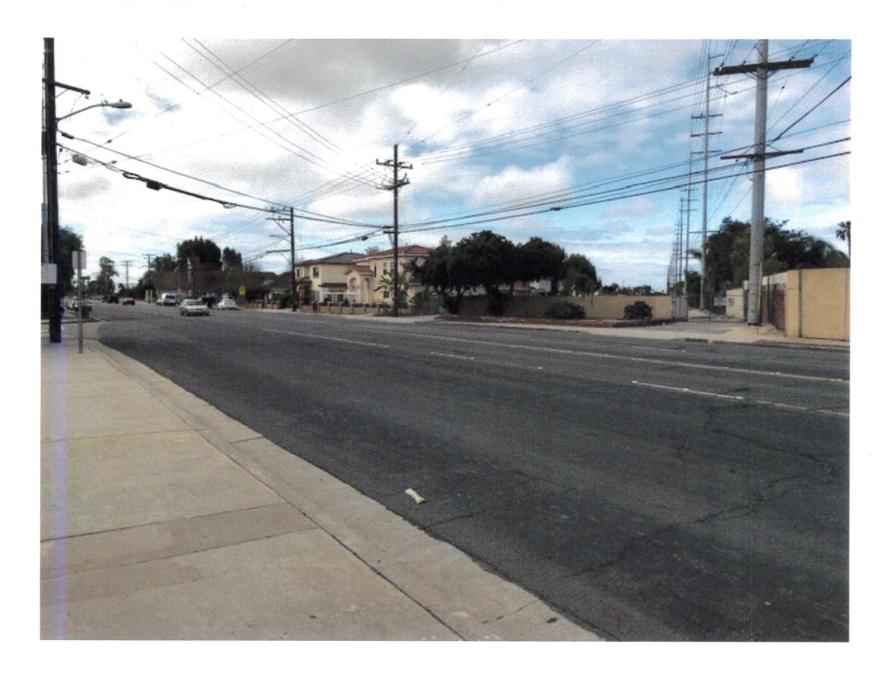


Photo No. 1



Photo No. 1
Transverse cracks with efflorescense inside Box 2 Soffit



Photo No. 1
Transverse cracks with efflorescense inside Box 1 Soffit