




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street:OSO_PKWY Cross Street:ANTONIO_PKWY Location: NW

ADA ID: CCAT220208132212 Curb Cut Type:IslandRefuge3 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 50

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

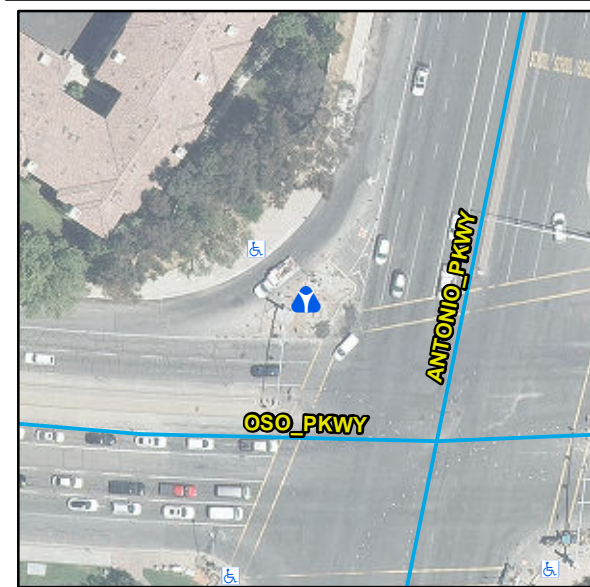

Possible Solutions:
Install Detectable Warning System. Restripe Crosswalk. Remove & Replace Gutter.

Surveyor Notes:
N/A

OC Std/PROW:
R305, R207.1, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ **6304**

Parcel ID Number **787-271-04**

Google Street View Link
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.5838332,-117.63088173

Street 1 Name **OSO_PKWY**

Stop Condition-Street 1 **N/A**

Street 2 Name **ANTONIO_PKWY**

Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	64	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	90	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	4.1	No	Gutter 1 Slope (%)	5.5
Yes	Refuge 1 Cross Slope (%)	2.51	Yes	Gutter 1 Cross Slope (%)	1.8
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No
	Cross Walk 1 Direction	E	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	5.3	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1.73			
Yes	Refuge 2 Length (In)	64	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	90	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	3.4	Yes	Gutter 2 Slope (%)	1.9
Yes	Refuge 2 Cross Slope (%)	3.2	No	Gutter 2 Cross Slope (%)	5.2
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No
	Cross Walk 2 Direction	S	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	145	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	1.5	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.9			
Yes	Refuge 3 Length (In)		Yes	Guttter 3 Ponding	No
Yes	Refuge 3 Width (In)	90	Yes	Gutter 3 Lip Ht (In)	0
Yes	Refuge 3 Slope (%)	0.86	Yes	Gutter 3 Slope (%)	3.4
Yes	Refuge 3 Cross Slope (%)	3.2	Yes	Gutter 3 Cross Slope (%)	3.5
N/A	Painted Cross Walk 3	Yes	No	DWS 3 Provided	No
	Cross Walk 3 Direction	NE	N/A	DWS 3 Contrast	N/A
N/A	Cross Walk 3 Width (In)	144	N/A	DWS 3 Length (In)	N/A
No	Refuge Inside Cross Walk 3	No	N/A	DWS 3 Full Width	N/A
	Road 3 Slope (%)	1.2	N/A	DWS 3 Offset (In)	N/A
	Road 3 Cross Slope (%)	3.31			
Yes	Overall Surface Condition:	Acceptable			