


Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: TERRACE RD Cross Street:TERRACE_RD Location: W ADA ID: CCRK211110120815 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

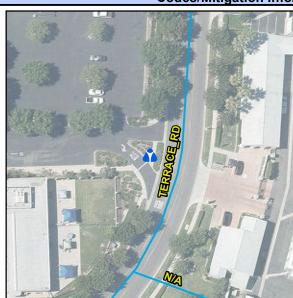

Possible Solutions: Remove & Replace Entire Refuge.

Surveyor Notes:

N/A

OC Std/PROW:

R302.3.1, STD 1115

Total Cost:

5000

780-243-22 Street 1 Name Parcel ID Number

TERRACE_RD N/A Stop Condition-Street 1

Street 2 Name TERRACE_RD Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55686746,-117.62812321

Obstruction and Utility Measurement/Component Compliance

Compliance Description	Data	Compliance Description	Data
Yes Obstructions Present?	No	N/A Utilities Present?	No
Obstruction Types	N/A	Utility Types	
Obstruction Dimensions	N/A		N/A



Google Street View Link





Field Measurements/Component Compliance									
	Com	pliance Description	Data	Com	pliance Description	Data			
	Yes	Refuge 1 Length (In)	72	N/A	Guttter 1 Ponding	N/A			
	No	Refuge 1 Width (In)	46	Yes	Gutter 1 Lip Ht (In)	0			
	Yes	Refuge 1 Slope (%)	1	N/A	Gutter 1 Slope (%)	N/A			
	Yes	Refuge 1 Cross Slope (%)	3.3	N/A	Gutter 1 Cross Slope (%)	N/A			
	N/A	Painted Cross Walk 1	No	N/A	DWS 1 Provided	N/A			
		Cross Walk 1 Direction	N	N/A	DWS 1 Contrast	N/A			
		Cross Walk 1 Width (In)	N/A	N/A	DWS 1 Length (In)	N/A			
	N/A	Refuge Inside Cross Walk 1	N/A	N/A	DWS 1 Full Width	N/A			
		Road 1 Slope (%)	1.6	N/A	DWS 1 Offset (In)	N/A			
		Road 1 Cross Slope (%)	0			N/A			
	Yes	Refuge 2 Length (In)	73	N/A	Guttter 2 Ponding	N/A			
	No	Refuge 2 Width (In)	46	Yes	Gutter 2 Lip Ht (In)	0			
	Yes	Refuge 2 Slope (%)	2.1	N/A	Gutter 2 Slope (%)	N/A			
	Yes	Refuge 2 Cross Slope (%)	1.7	N/A	Gutter 2 Cross Slope (%)	N/A			
00	N/A	Painted Cross Walk 2	No	N/A	DWS 2 Provided	N/A			
		Cross Walk 2 Direction	S	N/A	DWS 2 Contrast	N/A			
D		Cross Walk 2 Width (In)	N/A	N/A	DWS 2 Length (In)	N/A			
Ά	N/A	Refuge Inside Cross Walk 2	N/A	N/A	DWS 2 Full Width	N/A			
D		Road 2 Slope (%)	6.3	N/A	DWS 2 Offset (In)	N/A			
Α		Road 2 Cross Slope (%)	1						
	Yes	Overall Surface Condition: Accep	otable						
			,	,					