

ADA ID: CCRK211118134810

Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



15


Severity Score:

Main Street: REATA RD **Cross Street:REATA_RD** Location:

Initial Pass/Fail: Pass

Codes/Mitigation Info/Possible Solution

Overall Compliance: No

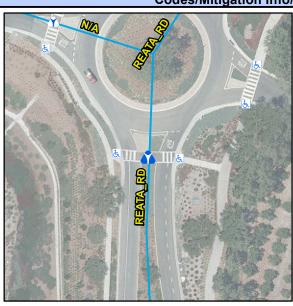

Possible Solutions: Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

Curb Cut Type: MedianRefuge2

N/A

OC Std/PROW:

R305, R304.5.3, STD 1115

Total Cost: 1704

741-591-28 Street 1 Name REATA_RD Parcel ID Number Stop Condition-Street 1 N/A Street 2 Name REATA_RD Google Street View Link Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.52121596,-117.62804978

Obstruction and Utility Measurement/Component Compliance

Compliance Description Data		Com	pliance Description	<u>Data</u>	
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Field Measurements/Component Compliance										
	Compliance Description		Data	Compliance Description		Data				
	Yes	Refuge 1 Length (In)	124	Yes	Guttter 1 Ponding	No				
	Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0				
	Yes	Refuge 1 Slope (%)	0.6	Yes	Gutter 1 Slope (%)	3.5				
	Yes	Refuge 1 Cross Slope (%)	2.9	No	Gutter 1 Cross Slope (%)	3.6				
	N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No				
		Cross Walk 1 Direction	Е	N/A	DWS 1 Contrast	N/A				
		Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A				
	Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A				
		Road 1 Slope (%)	2.8	N/A	DWS 1 Offset (In)	N/A				
		Road 1 Cross Slope (%)	4			N/A				
	Yes	Refuge 2 Length (In)	125	Yes	Guttter 2 Ponding	No				
	Yes	Refuge 2 Width (In)	86	Yes	Gutter 2 Lip Ht (In)	0				
	Yes	Refuge 2 Slope (%)	1.5	Yes	Gutter 2 Slope (%)	0.3				
	Yes	Refuge 2 Cross Slope (%)	2.2	No	Gutter 2 Cross Slope (%)	3.8				
ı	N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No				
•		Cross Walk 2 Direction	W	N/A	DWS 2 Contrast	N/A				
)		Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A				
١.	Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A				
)		Road 2 Slope (%)	1.3	N/A	DWS 2 Offset (In)	N/A				
١.		Road 2 Cross Slope (%)	3.5							
	Yes	Overall Surface Condition: Acce	ptable							