


## **Access Compliance Report Public Rights-of-Way** (Island Curb Cuts)



Main Street: FAUNA\_DR Cross Street:CHIQUITA\_CANYON\_DR Location: NE **Severity Score:** ADA ID: CCRK211124124117 Curb Cut Type: MedianRefuge2 **Initial Pass/Fail: Pass Overall Compliance: Yes** 

**Codes/Mitigation Info/Possible Solution** 

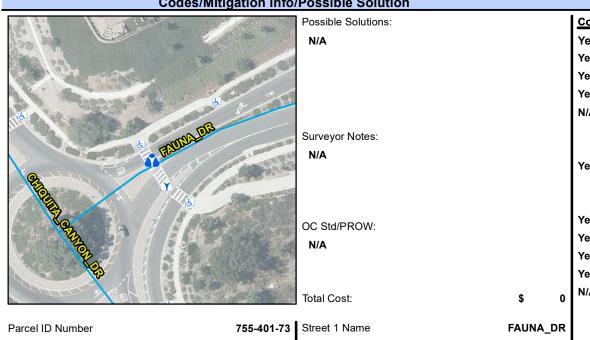

Parcel ID Number	755-401-73	Street 1 Name	FAUNA_DR
		Stop Condition-Street 1	N/A
		Street 2 Name	CHIQUITA_CANYON_DR
Google Street View Link		Stop Condition-Street 2	N/A
http://www.google.com/mans/@2ani=1&man_action	=nano&viewnoint=33 53	350934 -117 60728697	

**Obstruction and Utility Measurement/Component Compliance** 

Compliance Description	Data	Compliance Description	Data
Yes Obstructions Present?	No	N/A Utilities Present?	No
Obstruction Types	N/A	Utility Types	
Obstruction Dimensions	N/A		N/A



Field Measurements/Component Compliance								
1	Com	pliance Description	Data	Com	pliance Description	Data		
	Yes	Refuge 1 Length (In)	65	Yes	Guttter 1 Ponding	No		
	Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0		
	Yes	Refuge 1 Slope (%)	2.1	Yes	Gutter 1 Slope (%)	0.7		
	Yes	Refuge 1 Cross Slope (%)	0.4	Yes	Gutter 1 Cross Slope (%)	0.2		
	N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes		
		Cross Walk 1 Direction	SE	Yes	DWS 1 Contrast	Yes		
		Cross Walk 1 Width (In)	150	Yes	DWS 1 Length (In)	36		
	Yes	Refuge Inside Cross Walk 1	Yes	Yes	DWS 1 Full Width	Yes		
		Road 1 Slope (%)	0.3	Yes	DWS 1 Offset (In)	0		
		Road 1 Cross Slope (%)	0.4			N/A		
	Yes	Refuge 2 Length (In)	64	Yes	Guttter 2 Ponding	No		
	Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0		
	Yes	Refuge 2 Slope (%)	1.2	Yes	Gutter 2 Slope (%)	2.7		
	Yes	Refuge 2 Cross Slope (%)	3.8	Yes	Gutter 2 Cross Slope (%)	1.7		
	N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes		
		Cross Walk 2 Direction	N	Yes	DWS 2 Contrast	Yes		
2		Cross Walk 2 Width (In)	150	Yes	DWS 2 Length (In)	36		
١.	Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes		
2		Road 2 Slope (%)	2.9	Yes	DWS 2 Offset (In)	0		
١		Road 2 Cross Slope (%)	1.4					
	Yes	Overall Surface Condition: Acce	ptable					
			l.	•				