




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: FAUNA_DR		Cross Street: CHIQUITA_CANYON_DR		Location:	S
ADA ID: CCRK211124125639	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	10
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

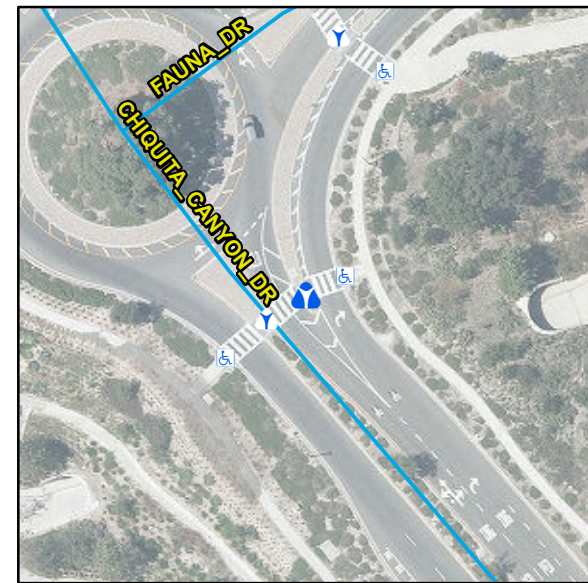

Possible Solutions:

Remove & Replace Entire Refuge. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305.2.4, R305, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ 5504

Parcel ID Number 755-301-24

Street 1 Name FAUNA_DR

Stop Condition-Street 1 N/A

Street 2 Name CHIQUITA_CANYON_DR

Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53306765,-117.60728496

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
No	Refuge 1 Length (In)	34	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	3.6	No	Gutter 1 Slope (%)	5.8
Yes	Refuge 1 Cross Slope (%)	2.7	No	Gutter 1 Cross Slope (%)	2.1
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	Yes
	Cross Walk 1 Direction	W	N/A	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	152	N/A	DWS 1 Length (In)	34
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	Yes
	Road 1 Slope (%)	3.7	N/A	DWS 1 Offset (In)	0
	Road 1 Cross Slope (%)	2.3			N/A
No	Refuge 2 Length (In)	34	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	3.7	No	Gutter 2 Slope (%)	6.8
Yes	Refuge 2 Cross Slope (%)	2.6	Yes	Gutter 2 Cross Slope (%)	0.6
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	Yes
	Cross Walk 2 Direction	E	N/A	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	152	N/A	DWS 2 Length (In)	34
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	Yes
	Road 2 Slope (%)	5	N/A	DWS 2 Offset (In)	0
	Road 2 Cross Slope (%)	0.5			
Yes	Overall Surface Condition: Acceptable				

