




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: CHIQUITA_CANYON_DR		Cross Street: CHIQUITA_CANYON_DR		Location:	S
ADA ID: CCRK211124131450	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

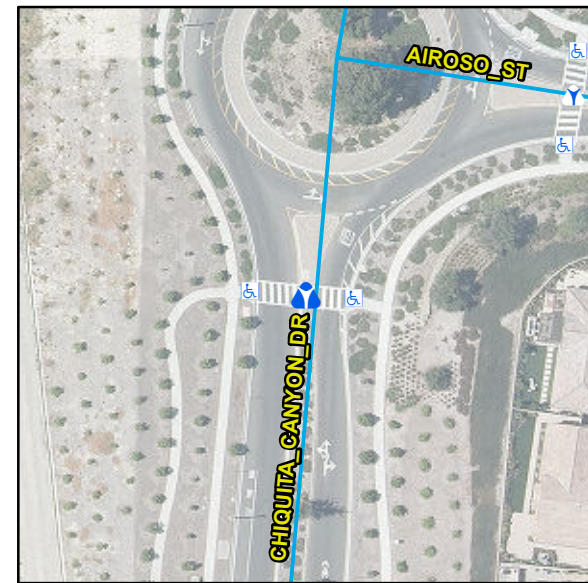

Possible Solutions:

Remove & Replace Entire Refuge.

Surveyor Notes:

N/A

OC Std/PROW:

R302.5, STD 1115

Total Cost: \$ 5000

Parcel ID Number 755-301-16

Street 1 Name CHIQUITA_CANYON_DR

Stop Condition-Street 1 N/A

Street 2 Name CHIQUITA_CANYON_DR

Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.5380343,-117.60839956

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	42	N/A	Guttter 1 Ponding	N/A
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
No	Refuge 1 Slope (%)	5.7	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 Cross Slope (%)	4.3	N/A	Gutter 1 Cross Slope (%)	N/A
N/A	Painted Cross Walk 1	Yes	N/A	DWS 1 Provided	N/A
	Cross Walk 1 Direction	W	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	150	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	2.3	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1.8			N/A
Yes	Refuge 2 Length (In)	42	N/A	Guttter 2 Ponding	N/A
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
No	Refuge 2 Slope (%)	5.1	N/A	Gutter 2 Slope (%)	N/A
Yes	Refuge 2 Cross Slope (%)	4	N/A	Gutter 2 Cross Slope (%)	N/A
N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A
	Cross Walk 2 Direction	E	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	150	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	5.6	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	2.3			
Yes	Overall Surface Condition:	Acceptable			