


## **Access Compliance Report Public Rights-of-Way** (Island Curb Cuts)



Main Street: 17TH\_ST **Cross Street:NEWPORT\_AVE** Location: NW ADA ID: CCRK211228155404 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

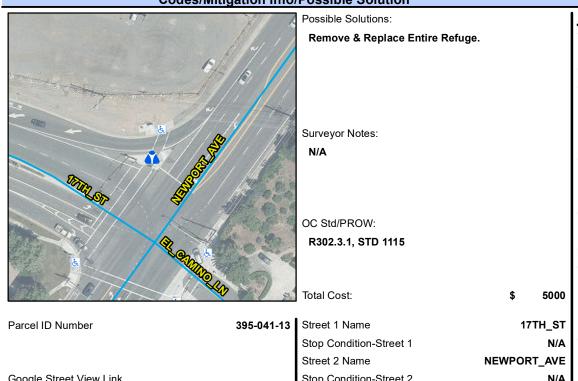

Parcel ID Number	395-041-13	Street 1 Name	17TH_ST				
		Stop Condition-Street 1	N/A				
		Street 2 Name	NEWPORT_AVE				
Google Street View Link		Stop Condition-Street 2	N/A				
http://www.google.com/maps/@?api=1↦_action=pano&viewpoint=33.75891128,-117.80202532							

## **Obstruction and Utility Measurement/Component Compliance**

Com	pliance Description	Data	Com	pliance Description	<u>Data</u>
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Field Measurements/Component Compliance								
1	Com	pliance Description	Data	Com	pliance Description	Data		
	Yes	Refuge 1 Length (In)	100	N/A	Guttter 1 Ponding	N/A		
	No	Refuge 1 Width (In)	34	Yes	Gutter 1 Lip Ht (In)	0		
	Yes	Refuge 1 Slope (%)	1.1	N/A	Gutter 1 Slope (%)	N/A		
	Yes	Refuge 1 Cross Slope (%)	0.6	N/A	Gutter 1 Cross Slope (%)	N/A		
	N/A	Painted Cross Walk 1	Yes	N/A	DWS 1 Provided	N/A		
		Cross Walk 1 Direction	N	N/A	DWS 1 Contrast	N/A		
		Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A		
	Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A		
		Road 1 Slope (%)	1.2	N/A	DWS 1 Offset (In)	N/A		
		Road 1 Cross Slope (%)	4.1			N/A		
	Yes	Refuge 2 Length (In)	100	N/A	Guttter 2 Ponding	N/A		
	No	Refuge 2 Width (In)	34	Yes	Gutter 2 Lip Ht (In)	0		
	Yes	Refuge 2 Slope (%)	1.1	N/A	Gutter 2 Slope (%)	N/A		
	Yes	Refuge 2 Cross Slope (%)	1	N/A	Gutter 2 Cross Slope (%)	N/A		
,	N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A		
		Cross Walk 2 Direction	W	N/A	DWS 2 Contrast	N/A		
•		Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A		
۱	Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A		
:		Road 2 Slope (%)	1.2	N/A	DWS 2 Offset (In)	N/A		
۱		Road 2 Cross Slope (%)	8.0					
	Yes	Overall Surface Condition: Accep	ptable					
				J				