



Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: CARBON_CANYON_RD Cross Street: VALENCIA_AVE Location: SE

ADA ID: CCRK220201121941 Curb Cut Type: IslandRefuge3 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



Possible Solutions:

**Remove & Replace Detectable Warning System.
Utility Present.**

Surveyor Notes:

N/A

OC Std/PROW:

R305.2, STD 1115

Total Cost: \$ 2400

Parcel ID Number 322-031-01

Street 1 Name CARBON_CANYON_RD

Stop Condition-Street 1 N/A

Street 2 Name VALENCIA_AVE


Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.92396588,-117.84747264

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Push Button	

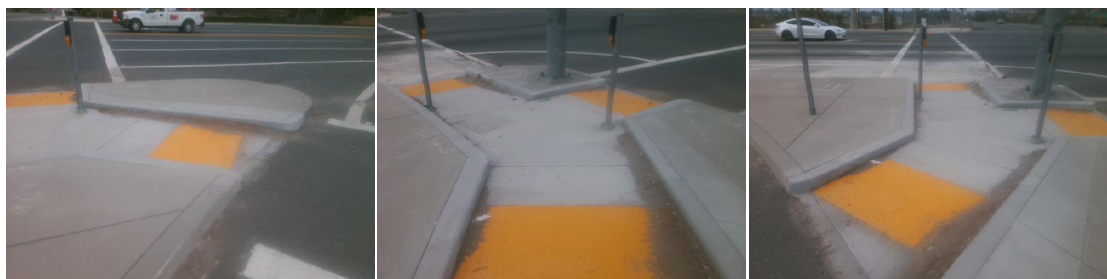

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	53	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	61	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	0.6	Yes	Gutter 1 Slope (%)	1.9
Yes	Refuge 1 Cross Slope (%)	0.4	Yes	Gutter 1 Cross Slope (%)	1
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	N	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	Yes	DWS 1 Full Width	Yes
	Road 1 Slope (%)	2.9	No	DWS 1 Offset (In)	4
	Road 1 Cross Slope (%)	0.5			
Yes	Refuge 2 Length (In)	98	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	61	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	3.7	Yes	Gutter 2 Slope (%)	1.4
Yes	Refuge 2 Cross Slope (%)	0.9	Yes	Gutter 2 Cross Slope (%)	1.9
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	W	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes
	Road 2 Slope (%)	0.4	No	DWS 2 Offset (In)	6
	Road 2 Cross Slope (%)	1.4			
Yes	Refuge 3 Length (In)		Yes	Guttter 3 Ponding	No
Yes	Refuge 3 Width (In)	61	Yes	Gutter 3 Lip Ht (In)	0
Yes	Refuge 3 Slope (%)	0.8	Yes	Gutter 3 Slope (%)	0.3
Yes	Refuge 3 Cross Slope (%)	0.8	Yes	Gutter 3 Cross Slope (%)	0.1
N/A	Painted Cross Walk 3	Yes	Yes	DWS 3 Provided	Yes
	Cross Walk 3 Direction	SE	Yes	DWS 3 Contrast	Yes
N/A	Cross Walk 3 Width (In)	144	Yes	DWS 3 Length (In)	36
Yes	Refuge Inside Cross Walk 3	Yes	Yes	DWS 3 Full Width	Yes
	Road 3 Slope (%)	2.9	No	DWS 3 Offset (In)	16
	Road 3 Cross Slope (%)	0.1			
Yes	Overall Surface Condition:	Acceptable			