

Access Compliance Report Public Rights-of-Way (Island Curb Cuts)




Main Street: BOLSA_AVE_FRONTAGE_ROAD Cross Street: PURDY_ST Location:

ADA ID: CCRK220203143945 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

9000

Codes/Mitigation Info/Possible Solution

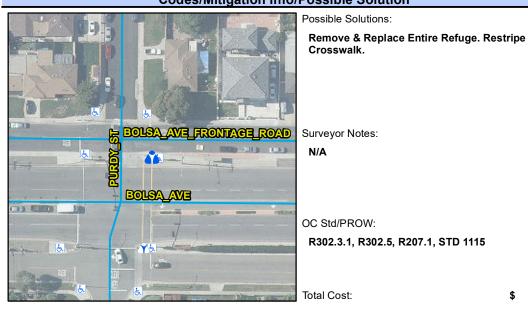

Parcel ID Number	097-455-14	Street 1 Name	BOLSA_AVE_FR	ONTAGE_ROAD
		Stop Condition-S	treet 1	N/A
		Street 2 Name		PURDY_ST
Google Street View Link		Stop Condition-S	treet 2	N/A
http://www.google.com/mone/@2cmi=4.8 mon.gotion		102050 447 07700240		

<u> http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74492659,-117.97789318</u>

Obstruction and Utility Measurement/Component Compliance

Com	pliance Description	Data	Com	pliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities	Present?	No
	Obstruction Types	N/A		Utility T	ypes	
	Obstruction Dimensions	N/A				N/A



Field Measurements/Component Compliance							
Com	pliance Description	Data	Com	pliance Description	Data		
Yes	Refuge 1 Length (In)	44	N/A	Guttter 1 Ponding	N/A		
No	Refuge 1 Width (In)	48	Yes	Gutter 1 Lip Ht (In)	0		
No	Refuge 1 Slope (%)	5.5	N/A	Gutter 1 Slope (%)	N/A		
Yes	Refuge 1 Cross Slope (%)	1.9	N/A	Gutter 1 Cross Slope (%)	N/A		
N/A	Painted Cross Walk 1	No	N/A	DWS 1 Provided	N/A		
	Cross Walk 1 Direction	N	N/A	DWS 1 Contrast	N/A		
	Cross Walk 1 Width (In)	N/A	N/A	DWS 1 Length (In)	N/A		
N/A	Refuge Inside Cross Walk 1	N/A	N/A	DWS 1 Full Width	N/A		
	Road 1 Slope (%)	1.1	N/A	DWS 1 Offset (In)	N/A		
	Road 1 Cross Slope (%)	0.2			N/A		
Yes	Refuge 2 Length (In)	44	N/A	Guttter 2 Ponding	N/A		
No	Refuge 2 Width (In)	48	Yes	Gutter 2 Lip Ht (In)	0		
Yes	Refuge 2 Slope (%)	1.4	N/A	Gutter 2 Slope (%)	N/A		
Yes	Refuge 2 Cross Slope (%)	0.1	N/A	Gutter 2 Cross Slope (%)	N/A		
N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A		
	Cross Walk 2 Direction	s	N/A	DWS 2 Contrast	N/A		
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A		
No	Refuge Inside Cross Walk 2	No	N/A	DWS 2 Full Width	N/A		
	Road 2 Slope (%)	1.5	N/A	DWS 2 Offset (In)	N/A		
	Road 2 Cross Slope (%)	1.9					
Yes	Overall Surface Condition: Acce	eptable					