



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **HAMER_LN** Cross Street: **YORBA_LINDA_BLV** Location: **SW**

ADA ID: **RPAT210917133107** Ramp Type: **Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass** Overall Compliance: **No** Severity Score: **6**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

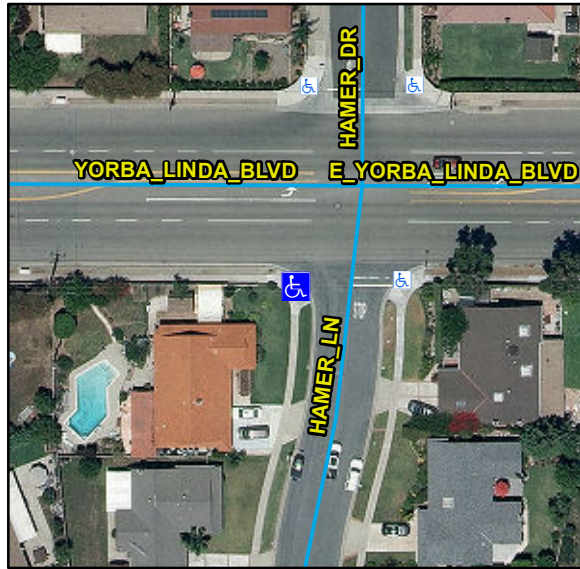

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.4, STD 1115

Total Cost: **\$ 6412**

Parcel ID Number: **340-253-01**
 Ramp Island Or Median: **None**
 Ramp Orientation: **Diag**
 Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.88921544,-117.84969577

Street 1 Name: **HAMER_LN**
 Stop Condition-Street 1: **StopSign**
 Street 2 Name: **YORBA_LINDA_BLV**
 Stop Condition-Street 2: **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59	N/A	Flare Type LT	
Yes	Ramp Width (in)	48		Flare Slope LT (%)	2.1
Yes	Ramp Run Slope (%)	5.5	N/A	Flare Traversable LT	No
Yes	Ramp Cross Slope (%)	1.8	N/A	Flare Type RT	
N/A	Landing Present	Yes		Flare Slope RT (%)	8.2
N/A	Landing Length (in)	50		Flare Traversable RT	No
Yes	Landing Width (in)	48	N/A	DWS Provided	Yes
No	Landing Run Slope (%)	2.3	N/A	DWS Contrast	Yes
Yes	Landing Cross Slope (%)	1.9	Yes	DWS Length (in)	36
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Full Width	Yes
	Landing Movement Type	Curb	Yes	DWS Offset Left (in)	0
N/A	Landing Shared	No	Yes	DWS Offset Right (in)	N/A
N/A	Clear Space	Yes	N/A	Marked Crosswalk 2	No
N/A	Clear Space To Crosswalk (in)	48	Yes	Crossing 1 Direction	E
N/A	Marked Crosswalk 1	No	N/A	Crossing 2 Direction	N
	Crossing 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A	Yes	Ramp Inside Crosswalk 2	N/A
N/A	Ramp Inside Crosswalk 1	N/A		Crossing 1 Slope (%)	3.8
	Crossing 1 Slope (%)	3.8		Crossing 2 Slope (%)	8.7
	Crossing 1 Cross Slope (%)	3.7		Crossing 2 Cross Slope (%)	1
Yes	Gutter Ponding	No	No	Curb Slope	5.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.5
No	Gutter Run Slope (%)	6.4		Road Cross Slope (%)	3.3
Yes	Gutter Cross Slope (%)	1.7			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

