



# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                           |                                  |                         |                        |                 |    |
|---------------------------|----------------------------------|-------------------------|------------------------|-----------------|----|
| Main Street: VALENCIA_AVE |                                  | Cross Street: BIRCH_ST  |                        | Location:       | NW |
| ADA ID: RPAT210920144940  | Ramp Type:Type 1 - Perpendicular | Initial Pass/Fail: Pass | Overall Compliance: No | Severity Score: | 5  |


| Codes/Mitigation Info/Possible Solution |  |  | Field Measurements/Component Compliance |  |  |
|-----------------------------------------|--|--|-----------------------------------------|--|--|
|-----------------------------------------|--|--|-----------------------------------------|--|--|

|             |                                                |                              |      |  |  |
|-------------|------------------------------------------------|------------------------------|------|--|--|
|             | Possible Solutions:                            |                              |      |  |  |
|             | Remove & Replace Entire Ramp. Utility Present. |                              |      |  |  |
|             | Surveyor Notes:                                |                              |      |  |  |
|             | N/A                                            |                              |      |  |  |
|             | OC Std/PROW:                                   |                              |      |  |  |
|             |                                                | R304.2.2, R304.5.3, STD 1115 |      |  |  |
| Total Cost: |                                                | \$                           | 3080 |  |  |

|                          |            |                         |              |
|--------------------------|------------|-------------------------|--------------|
| Parcel ID Number         | 320-071-31 | Street 1 Name           | VALENCIA_AVE |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | Signal       |
| Ramp Orientation         | NonDiag    | Street 2 Name           | BIRCH_ST     |
| Google Street View Link: |            | Stop Condition-Street 2 | N/A          |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.91858649,-117.84798493](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.91858649,-117.84798493)

| Obstruction and Utility Measurement/Component Compliance |                        |      |            |                     |      |
|----------------------------------------------------------|------------------------|------|------------|---------------------|------|
| Compliance                                               | Description            | Data | Compliance | Description         | Data |
| Yes                                                      | Obstructions Present?  | No   | N/A        | Utilities Present?  | Yes  |
|                                                          | Obstruction Types      | N/A  |            | Utility Types       |      |
|                                                          | Obstruction Dimensions | N/A  |            | Traffic Signal Pole |      |

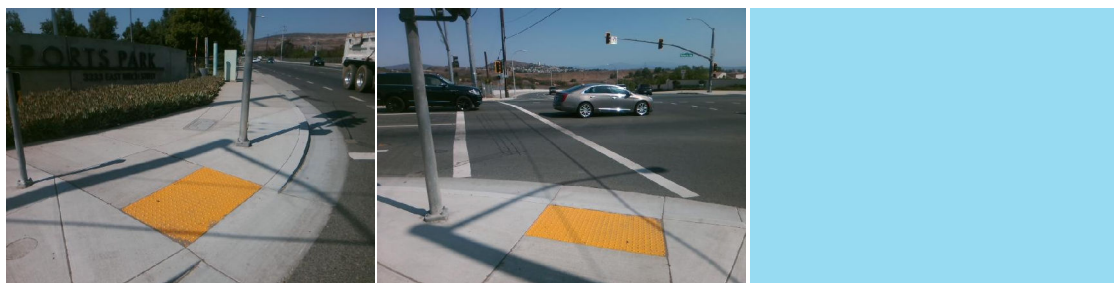

| Compliance | Description                           | Data | Compliance | Description                   | Data   |
|------------|---------------------------------------|------|------------|-------------------------------|--------|
| N/A        | Ramp Length (in)                      | 81   | N/A        | Flare Type LT                 |        |
| Yes        | Ramp Width (in)                       | 60   |            |                               | Sloped |
| Yes        | Ramp Run Slope (%)                    | 5.8  | Yes        | Flare Slope LT (%)            | 1.2    |
| Yes        | Ramp Cross Slope (%)                  | 3.5  | N/A        | Flare Traversable LT          | Yes    |
| N/A        | Landing Present                       | Yes  | N/A        | Flare Type RT                 |        |
| N/A        | Landing Length (in)                   | 74   |            |                               | Sloped |
| Yes        | Landing Width (in)                    | 61   | N/A        | Flare Slope RT (%)            | 9.7    |
| Yes        | Landing Run Slope (%)                 | 0.3  | N/A        | Flare Traversable RT          | No     |
| No         | Landing Cross Slope (%)               | 5.5  | Yes        | DWS Provided                  | Yes    |
| N/A        | Landing Movement Obstructed?          | No   | Yes        | DWS Contrast                  | Yes    |
|            | Landing Movement Type                 | N/A  | Yes        | DWS Length (in)               | 36     |
| N/A        | Landing Shared                        | No   | Yes        | DWS Full Width                | Yes    |
| N/A        | Clear Space                           | N/A  | Yes        | DWS Offset Left (in)          | 0      |
| N/A        | Clear Space To Crosswalk (in)         | N/A  | Yes        | DWS Offset Right (in)         | N/A    |
| N/A        | Marked Crosswalk 1                    | Yes  | N/A        | Marked Crosswalk 2            | N/A    |
|            | Crossing 1 Direction                  | E    |            | Crossing 2 Direction          | N/A    |
|            | Marked Crosswalk 1 Width (in)         | 120  |            | Marked Crosswalk 2 Width (in) | N/A    |
| Yes        | Ramp Inside Crosswalk 1               | Yes  | Yes        | Ramp Inside Crosswalk 2       | N/A    |
|            | Crossing 1 Slope (%)                  | 1.6  |            | Crossing 2 Slope (%)          | N/A    |
|            | Crossing 1 Cross Slope (%)            | 4.8  |            | Crossing 2 Cross Slope (%)    | N/A    |
| Yes        | Gutter Ponding                        | No   | No         | Curb Slope                    | 9.4    |
| Yes        | Gutter Lip Height (in)                | 0    |            | Road Run Slope (%)            | N/A    |
| Yes        | Gutter Run Slope (%)                  | 2.9  |            | Road Cross Slope (%)          | N/A    |
| Yes        | Gutter Cross Slope (%)                | 4.1  |            |                               |        |
| Yes        | Overall Surface Condition: Acceptable |      | Yes        | Perp Joint Present            | Yes    |
|            | Cross Gutter Present?                 | No   |            | Spandrel Present?             | No     |
|            | Replace Cross Gutter?                 | N/A  |            | Replace Spandrel?             | N/A    |