



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **BIRCH_ST** Cross Street: **VALENCIA_AVE** Location: **NW**

ADA ID: **RPAT210920145301** Ramp Type: **Type 1 - Perpendicular** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **15**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

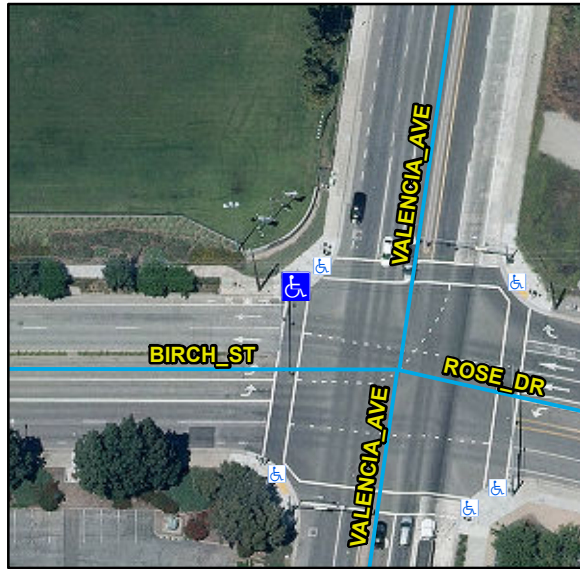

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, STD 1115

Total Cost:

\$ 3080

Parcel ID Number **320-071-31**

Ramp Island Or Median **None**

Ramp Orientation **NonDiag**

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.91855684,-117.8480293

Street 1 Name **BIRCH_ST**

Stop Condition-Street 1 **Signal**

Street 2 Name **VALENCIA_AVE**

Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			

Traffic Signal Pole

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	94	N/A	Flare Type LT	
Yes	Ramp Width (in)	60			N/A
Yes	Ramp Run Slope (%)	6.7	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	5.2	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.6		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3.6		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	4.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

