




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: N_OCEAN_VIEW_ST		Cross Street: BIXBY_AVE		Location:	NW
ADA ID: RPAT210924123014	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	15

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

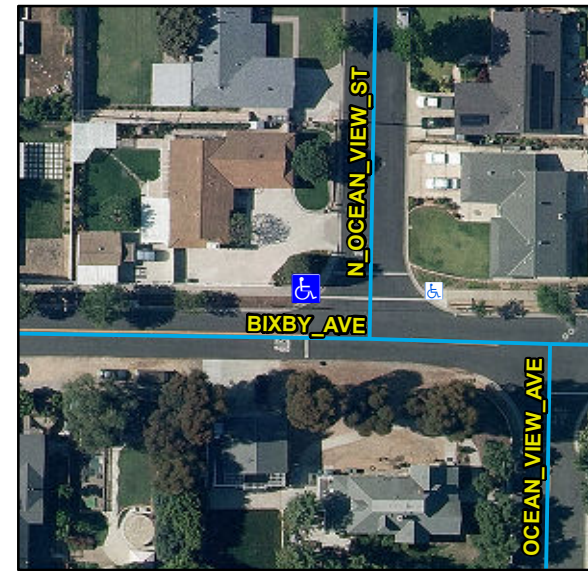

Possible Solutions:

Remove & Replace Entire Ramp. Restripe Crosswalk.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, STD 1115

Total Cost: \$ 7080

Parcel ID Number **360-334-07**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

Street 1 Name **N_OCEAN_VIEW_ST**
Stop Condition-Street 1 **StopSign**
Street 2 Name **BIXBY_AVE**
Stop Condition-Street 2 **N/A**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.83900162,-117.84032066

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	108	N/A	Flare Type LT	
Yes	Ramp Width (in)	56			N/A
No	Ramp Run Slope (%)	9.3	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	No	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	8.2		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3.6		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	No	Curb Slope	7.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

