



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: VINE_ST Cross Street: RANCHO_SANTIAGO_BLVD Location: NW

ADA ID: RPAT210928091930 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 16

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

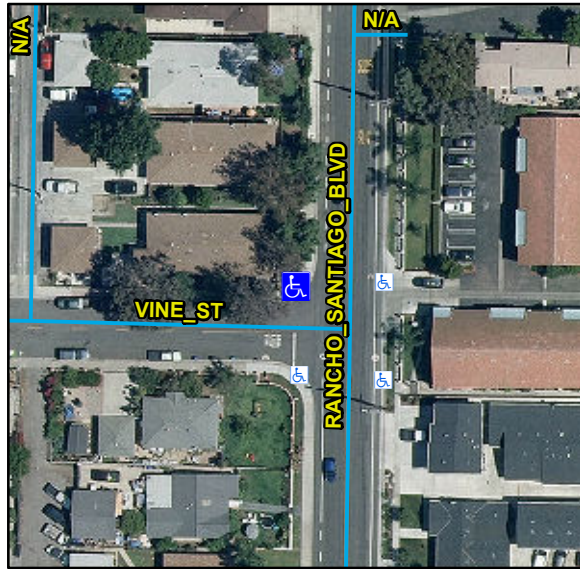

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.3.2, R304.5.3, STD 1115

Total Cost: \$ 4000

Parcel ID Number 383-081-78
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79053264,-117.80143396

Street 1 Name VINE_ST
Stop Condition-Street 1 StopSign
Street 2 Name RANCHO_SANTIAGO_BLVD
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	99	N/A	Ramp Length RT (in)	103
Yes	Ramp Width LT (in)	54	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	1.7	No	Ramp Run Slope RT (%)	10.2
Yes	Ramp Cross Slope LT (%)	1.4	No	Ramp Cross Slope RT (%)	2.4
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.6		Crossing 2 Slope (%)	9.3
	Crossing 1 Cross Slope (%)	7.5		Crossing 2 Cross Slope (%)	0.4
N/A	Gutter Ponding	N/A	N/A	Curb Slope	5.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.5
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	6.2
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

