




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LANESBORO_RD		Cross Street: STERLING_GLEN		Location:	SW
ADA ID: RPAT211101134821	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

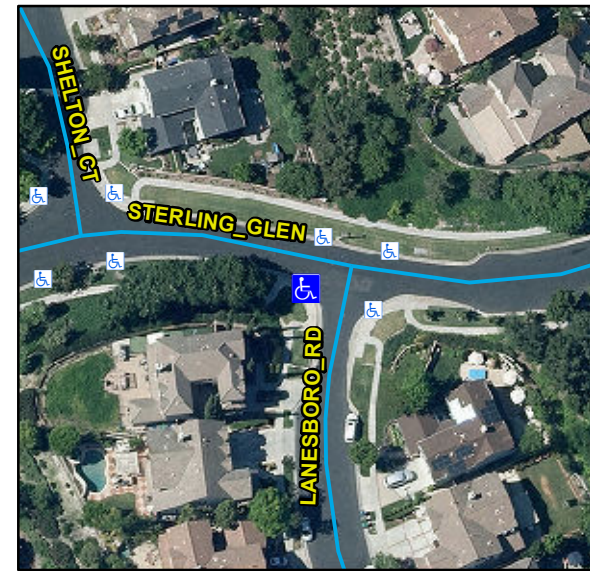

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.3.2, STD 1115


Total Cost: \$ 4000

Parcel ID Number	759-561-55	Street 1 Name	LANESBORO_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	STERLING_GLEN
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55823663,-117.63274709

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

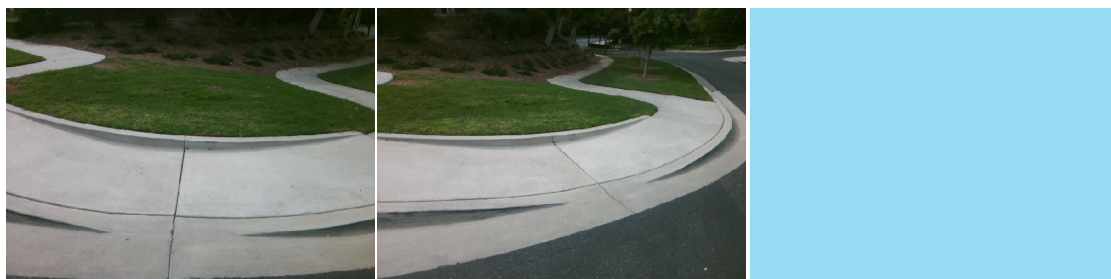

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	115	N/A	Ramp Length RT (in)	95
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
No	Ramp Run Slope LT (%)	12	Yes	Ramp Run Slope RT (%)	4.5
Yes	Ramp Cross Slope LT (%)	0.2	Yes	Ramp Cross Slope RT (%)	1.8
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	7.6		Crossing 2 Slope (%)	2.3
	Crossing 1 Cross Slope (%)	2.4		Crossing 2 Cross Slope (%)	8.8
N/A	Gutter Ponding	N/A	N/A	Curb Slope	12.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	6.7
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	7.5
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A