



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LEAFWOOD_LN		Cross Street: YORBA_ST		Location:	SE
ADA ID: RPAT220222165338	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Landing. Gutter Ponding Observed.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.5.3, R302.7, STD 1115


Total Cost: \$ 783

Parcel ID Number	395-263-07	Street 1 Name	LEAFWOOD_LN
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	NonDiag	Street 2 Name	YORBA_ST
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76565621,-117.82693234

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

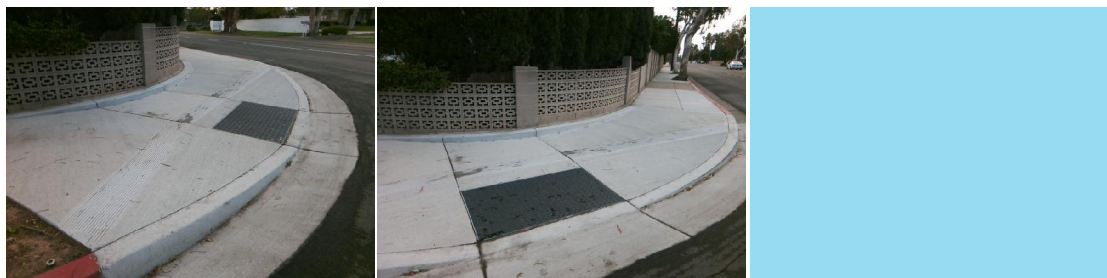

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48	N/A	Flare Type LT	
Yes	Ramp Width (in)	50			Sloped
Yes	Ramp Run Slope (%)	6.5	N/A	Flare Slope LT (%)	5.5
Yes	Ramp Cross Slope (%)	0	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	52			Sloped
Yes	Landing Width (in)	50	Yes	Flare Slope RT (%)	6.7
Yes	Landing Run Slope (%)	1.6	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	2.6	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	N		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.2		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	2.5		Crossing 2 Cross Slope (%)	N/A
No	Gutter Ponding	Yes	Yes	Curb Slope	4.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	4.5		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.6			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A