

ADA ID: RPRK210923181406


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: MILNEBURG_ST **Cross Street: BIENVILLE AVE** Location: NE

Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass

Overall Compliance: No Severity Score:

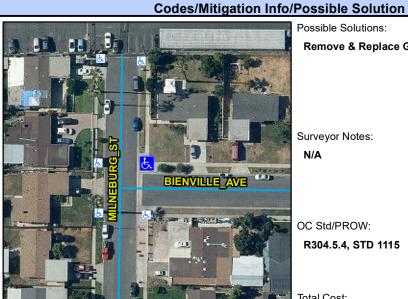

Possible Solutions: Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.4, STD 1115

Total Cost:

252

Parcel ID Number	127-351-12	Street 1 Name	MILNEBURG_ST
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	BIENVILLE_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.81672529,-117.9648601

Obstruction and Utility Measurement/Component Compliance

Com	pliance Description	Data	Compliance Description	Data
Yes	Obstructions Present?	No	N/A Utilities Present?	No
	Obstruction Types	N/A	Utility Types	
	Obstruction Dimensions	N/A		N/A



Field Measurements/Component Compliance									
	Compliance Description		Data	Com	Compliance Description		Data		
	N/A	Ramp Length (in)	124	N/A	Flare Ty	pe LT			
	Yes	Ramp Width (in)	48				Sloped		
	Yes	Ramp Run Slope (%)	5.6	N/A	Flare Slo	ppe LT (%)	5.4		
	Yes	Ramp Cross Slope (%)	0.5	N/A	Flare Traversable LT		No		
	N/A	Landing Present	Yes	N/A	Flare Ty	pe RT			
	N/A	Landing Length (in)	58				Sloped		
	Yes	Landing Width (in)	48	N/A	Flare Slo	ppe RT (%)	5.2		
	Yes	Landing Run Slope (%)	1.6	N/A	Flare Tra	aversable RT	No		
	Yes	Landing Cross Slope (%)	0.6	Yes	DWS Pr	ovided	Yes		
	N/A	Landing Movement Obstructed?	No	Yes	DWS Co	ontrast	Yes		
		Landing Movement Type	N/A	Yes	DWS Le	ngth (in)	36		
	N/A	Landing Shared	No	Yes	DWS Fu	ll Width	Yes		
	N/A	Clear Space	Yes	Yes	DWS Of	fset Left (in)	0		
	N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Of	fset Right (in)	N/A		
2	N/A	Marked Crosswalk 1	No	N/A	Marked	Crosswalk 2	No		
		Crossing 1 Direction	W		Crossing	g 2 Direction	S		
Т		Marked Crosswalk 1 Width (in)	N/A		Marked	Crosswalk 2 Width (in)	N/A		
ol	N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp In	side Crosswalk 2	N/A		
Ε		Crossing 1 Slope (%)	7.8		Crossing	g 2 Slope (%)	3.4		
ol		Crossing 1 Cross Slope (%)	1.1		Crossing	g 2 Cross Slope (%)	0.7		
	Yes	Gutter Ponding	No	Yes	Curb Slo	ppe	4.1		
	Yes	Gutter Lip Height (in)	0		Road R	un Slope (%)	1		
	No	Gutter Run Slope (%)	6.9		Road Cr	oss Slope (%)	4		
<u>а</u> О	Yes	Gutter Cross Slope (%)	1						
	Yes	Overall Surface Condition: Accep	otable	Yes	Perp Joi	nt Present	Yes		
		Cross Gutter Present?	Yes		Spandre	I Present?	Yes		
Α		Replace Cross Gutter?	No		Replace	Spandrel?	No		
	l								