



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: VAN_BUREN_ST Cross Street: MADISON_AVE Location: NE

ADA ID: RPRK211001193742 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 34

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

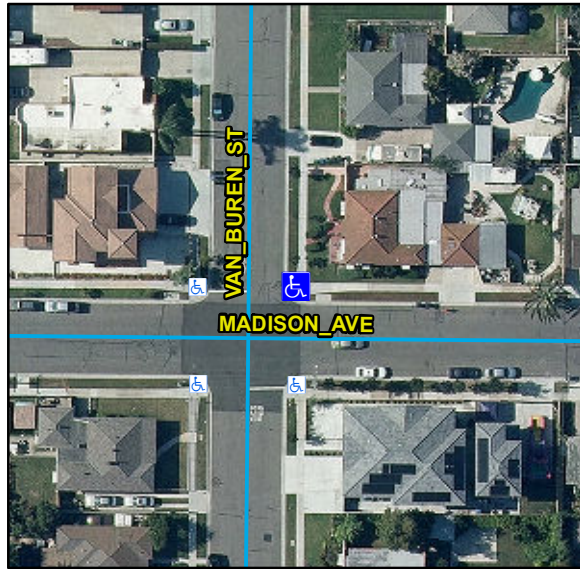

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.1, STD 1115

Total Cost: \$ 6160

Parcel ID Number 097-114-10
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74845587,-117.98631273

Street 1 Name VAN_BUREN_ST
Stop Condition-Street 1 StopSign
Street 2 Name MADISON_AVE
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	107	N/A	Flare Type LT	
No	Ramp Width (in)	36			N/A
No	Ramp Run Slope (%)	12.3	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.4	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	7.9		Crossing 2 Slope (%)	0.1
	Crossing 1 Cross Slope (%)	2.2		Crossing 2 Cross Slope (%)	1.8
N/A	Gutter Ponding	N/A	No	Curb Slope	8.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.7
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	2.2
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	Yes
	Replace Cross Gutter?	N/A		Replace Spandrel?	No

