




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: HARHAY_AVE **Cross Street:** PACIFIC_ST **Location:** SE

ADA ID: RPRK211005173127 **Ramp Type:** Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail **Overall Compliance:** No **Severity Score:** 30

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

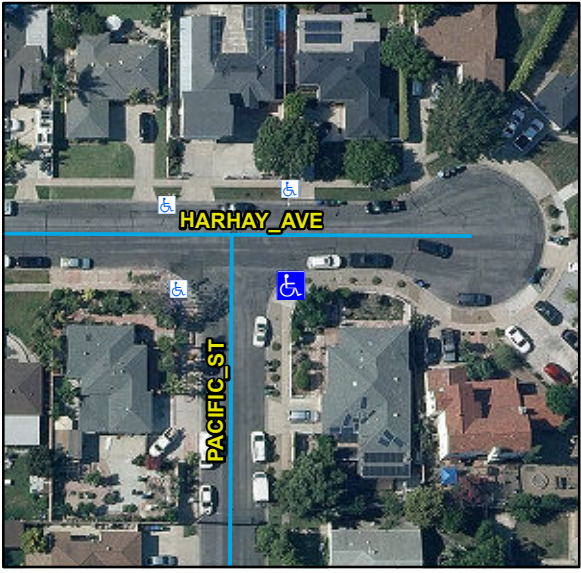

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R304.2.2, STD 1115

Total Cost: \$ 6160

Parcel ID Number: 142-061-27
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74059587,-117.99130192

Street 1 Name: HARHAY_AVE
Stop Condition-Street 1: NoControl
Street 2 Name: PACIFIC_ST
Stop Condition-Street 2: NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	14.5	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	8		Crossing 2 Slope (%)	2.3
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	3.5
N/A	Gutter Ponding	N/A	No	Curb Slope	7.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.8
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3.8
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

