




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: NEWPORT_AVE		Cross Street: LA_LOMA_DR		Location:	SE
ADA ID: RPRK211008141857	Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail		Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

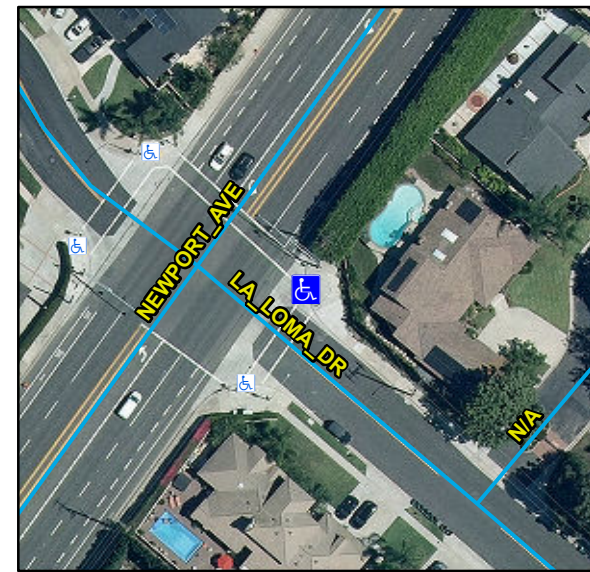

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115

Total Cost: \$ 6160

Parcel ID Number	502-221-06	Street 1 Name	NEWPORT_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	LA_LOMA_DR
Google Street View Link:		Stop Condition-Street 2	Signal

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76373874,-117.7975508

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	130	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	11.5	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.2	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	100		Marked Crosswalk 2 Width (in)	100
N/A	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	10.5		Crossing 2 Slope (%)	0.4
	Crossing 1 Cross Slope (%)	4.6		Crossing 2 Cross Slope (%)	0.2
N/A	Gutter Ponding	N/A	No	Curb Slope	16.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.4
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	6.3
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

