



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: MEANDERING_TRAIL **Cross Street:** OSO_PKWY **Location:** SW

ADA ID: RPRK211019150223 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 30

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

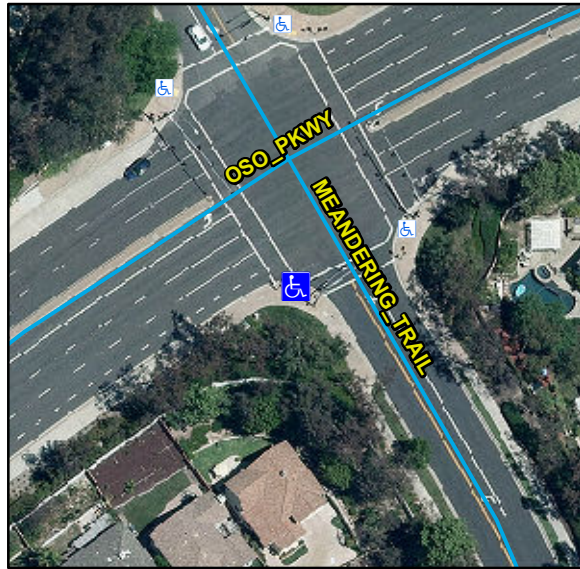

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R204.3, R304.5.3, STD 1115

Total Cost: \$ 4000

Parcel ID Number: 780-211-45
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58651996,-117.62360455

Street 1 Name: MEANDERING_TRAIL
Stop Condition-Street 1: Signal
Street 2 Name: OSO_PKWY
Stop Condition-Street 2: Signal

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	114	N/A	Ramp Length RT (in)	110
Yes	Ramp Width LT (in)	100	Yes	Ramp Width RT (in)	100
Yes	Ramp Run Slope LT (%)	4.3	Yes	Ramp Run Slope RT (%)	0.4
No	Ramp Cross Slope LT (%)	7.3	No	Ramp Cross Slope RT (%)	6
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	E		Crossing 2 Direction	N
N/A	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	8.2		Crossing 2 Slope (%)	0
	Crossing 1 Cross Slope (%)	2.1		Crossing 2 Cross Slope (%)	6.2
N/A	Gutter Ponding	N/A	Yes	Curb Slope	7.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.8
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	9.9
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable		Spandrel Present?	No
	Cross Gutter Present?	No		Replace Spandrel?	N/A
	Replace Cross Gutter?	N/A			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

