




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CECIL_PASTURE_RD Cross Street: CECIL_PASTURE_RD Location: W

ADA ID: RPRK211102124739 Ramp Type: Type 1 - Perpendicular Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

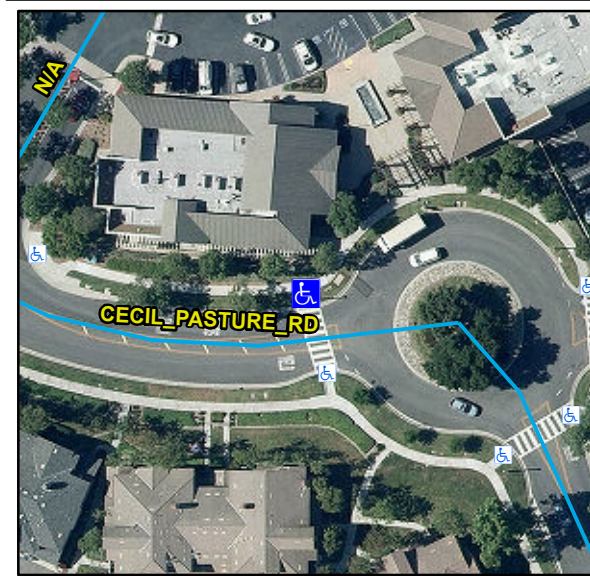

Possible Solutions:
N/A

Surveyor Notes:
N/A

OC Std/PROW:
N/A

Total Cost: \$ 0

Parcel ID Number 759-351-18
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56196418,-117.64714644

Street 1 Name CECIL_PASTURE_RD
Stop Condition-Street 1 YieldSign
Street 2 Name CECIL_PASTURE_RD
Stop Condition-Street 2 N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	91	Yes	Flare Type LT	
Yes	Ramp Width (in)	48			Curbed2
Yes	Ramp Run Slope (%)	6.7	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.9	N/A	Flare Traversable LT	N/A
N/A	Landing Present	Yes	Yes	Flare Type RT	
N/A	Landing Length (in)	60			Curbed2
Yes	Landing Width (in)	60	N/A	Flare Slope RT (%)	N/A
Yes	Landing Run Slope (%)	1.8	N/A	Flare Traversable RT	N/A
Yes	Landing Cross Slope (%)	1.6	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Bushes	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.9		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	3.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	4		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.9			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

