


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: HYDRANGEA_STCross Street: SKLAR_STLocation:SWADA ID: RPRK211103130947Ramp Type:Type 1 - PerpendicularInitial Pass/Fail: PassOverall Compliance: NoSeverity Score:16

Codes/Mitigation Info/Possible Solution

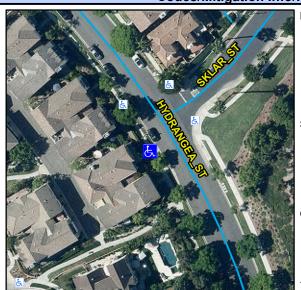

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number 759-532-07
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

759-532-07 Street 1 Name HYDRANGEA_ST
None Stop Condition-Street 1 NoControl
NonDiag Street 2 Name SKLAR_ST
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54744757,-117.63380873

Obstruction and Utility Measurement/Component Compliance

Com	pliance Description	Data	Com	pliance Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A	l		N/A



Field Measurements/Component Compliance										
1	Com	Compliance Description		Com	pliance Description	Data				
	N/A	Ramp Length (in)	43	N/A	Flare Type LT					
	Yes	Ramp Width (in)	48			Sloped				
	Yes	Ramp Run Slope (%)	7.6	N/A	Flare Slope LT (%)	11.5				
	Yes	Ramp Cross Slope (%)	3.1	N/A	Flare Traversable LT	No				
	N/A	Landing Present	Yes	N/A	Flare Type RT					
	N/A	Landing Length (in)	58			Sloped				
	Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	6.1				
	No	Landing Run Slope (%)	2.8	N/A	Flare Traversable RT	No				
	No	Landing Cross Slope (%)	2.8	No	DWS Provided	No				
	N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A				
		Landing Movement Type B	ushes	N/A	DWS Length (in)	N/A				
	N/A	Landing Shared	Yes	N/A	DWS Full Width	N/A				
	N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A				
	N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A				
2	N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A				
		Crossing 1 Direction	Ε		Crossing 2 Direction	N/A				
٠		Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A				
1	N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A				
•		Crossing 1 Slope (%)	4.7		Crossing 2 Slope (%)	N/A				
١		Crossing 1 Cross Slope (%)	3.6		Crossing 2 Cross Slope (%)	N/A				
	Yes	Gutter Ponding	No	No	Curb Slope	17.3				
	Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A				
	No	Gutter Run Slope (%)	9.8		Road Cross Slope (%)	N/A				
•	No	Gutter Cross Slope (%)	5.3							
'	Yes	Overall Surface Condition: Accep	ptable	Yes	Perp Joint Present	Yes				
		Cross Gutter Present?	No		Spandrel Present?	No				
١		Replace Cross Gutter?	N/A	J	Replace Spandrel?	N/A				