




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: BEACH_POINT Cross Street: BUSHWOOD_CIR Location: NW

ADA ID: RPRK211104135212 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 16

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

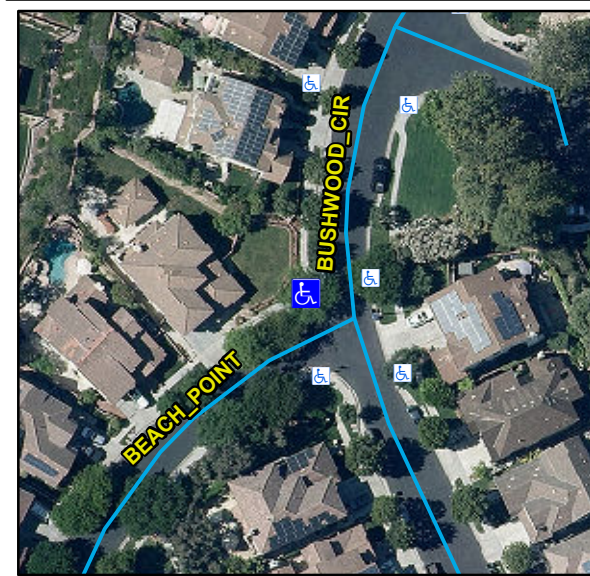

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

OC Std/PROW:
R204.3, R304.5.3, R304.3.2, STD 1115

Total Cost: \$ 4000

Parcel ID Number **759-431-44**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56155834,-117.64156386

Street 1 Name **BEACH_POINT**
Stop Condition-Street 1 **NoControl**
Street 2 Name **BUSHWOOD_CIR**
Stop Condition-Street 2 **NoControl**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	113	N/A	Ramp Length RT (in)	113
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	3.5	No	Ramp Run Slope RT (%)	9.7
No	Ramp Cross Slope LT (%)	3.2	No	Ramp Cross Slope RT (%)	3.9
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.6		Crossing 2 Slope (%)	2.4
	Crossing 1 Cross Slope (%)	1.5		Crossing 2 Cross Slope (%)	2.6
N/A	Gutter Ponding	N/A	N/A	Curb Slope	6.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.8
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	1.9
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

