




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: TREASURE_LN		Cross Street: ARROYO_AVE		Location:	S
ADA ID: RPRK220125140822	Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail		Overall Compliance: No	Severity Score:	60

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

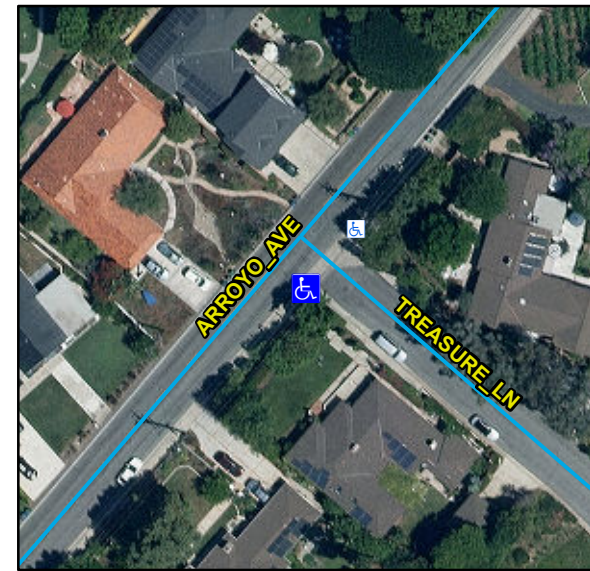

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2, R304.5.3, R302.7.2, STD 1115


Total Cost: \$ 6310

Parcel ID Number	502-281-01	Street 1 Name	TREASURE_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	ARROYO_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76511879,-117.78950179

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

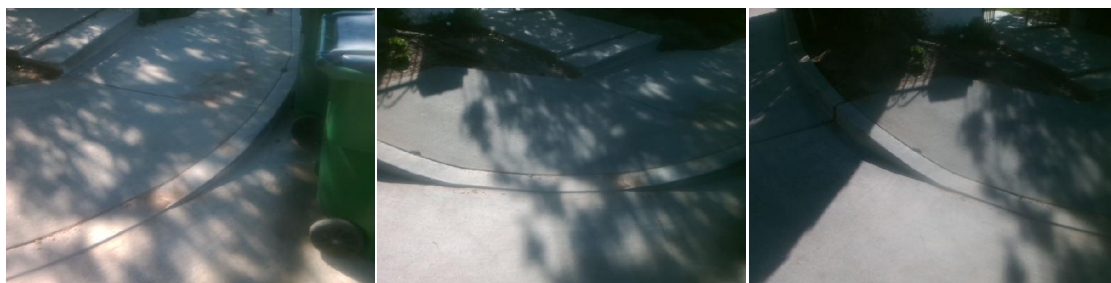

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	13.8	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	11.5	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	7.2		Crossing 2 Slope (%)	4.6
	Crossing 1 Cross Slope (%)	10.6		Crossing 2 Cross Slope (%)	4.3
N/A	Gutter Ponding	N/A	N/A	Curb Slope	2.4
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	7.9
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3.6
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No