



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: EMBARCADERO_PL		Cross Street: DANA_POINT_HARBOR_DR		Location:	SW
ADA ID: RPRK220208155140	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	16

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--



Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2, R304.5.3, STD 1115


Total Cost: \$ 3080

Parcel ID Number	682-022-24	Street 1 Name	EMBARCADERO_PL
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	NonDiag	Street 2 Name	DANA_POINT_HARBOR_DR
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.46247547,-117.69173755

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

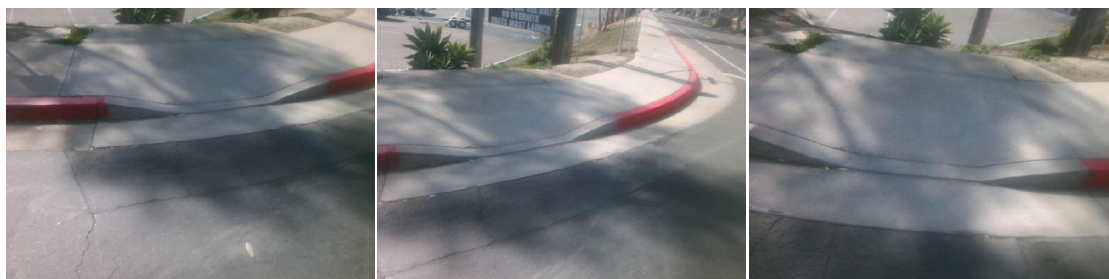

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	65	N/A	Flare Type LT	
Yes	Ramp Width (in)	60			N/A
No	Ramp Run Slope (%)	11.2	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	4.9	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.9		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	2.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A