




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LA_LOMA_DR Cross Street: LOMA_LINDA_WAY Location: SW

ADA ID: RPRK211012124835 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 20

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

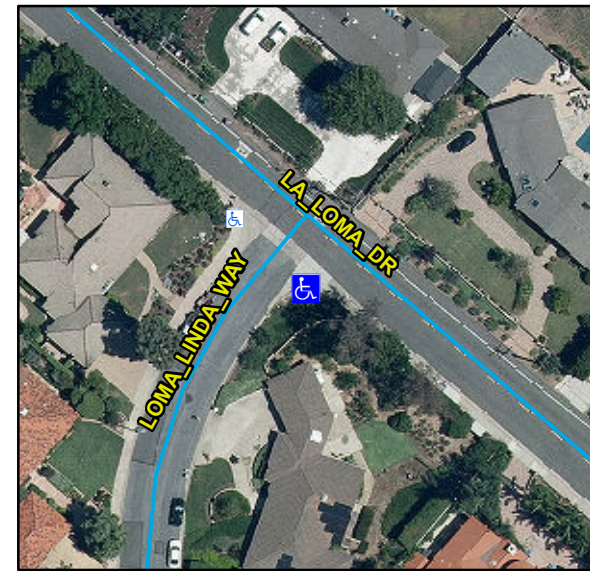

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, STD 1115

Total Cost: \$ 4000


Parcel ID Number 502-154-25
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name LA_LOMA_DR
Stop Condition-Street 1 NoControl
Street 2 Name LOMA_LINDA_WAY
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76025166,-117.79285598

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

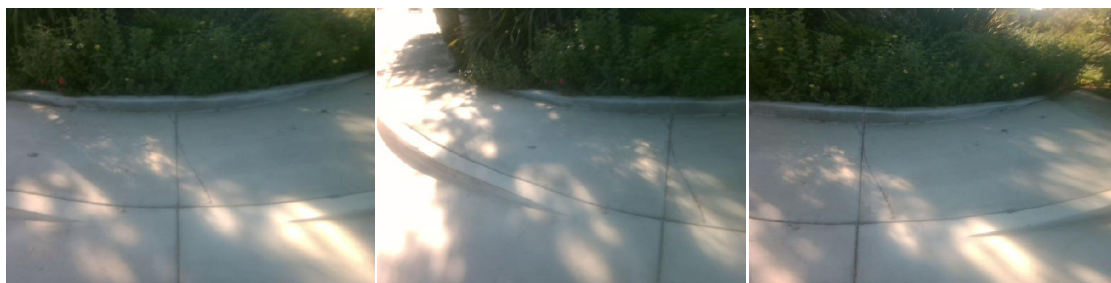

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	128	N/A	Ramp Length RT (in)	136
Yes	Ramp Width LT (in)	62	Yes	Ramp Width RT (in)	72
Yes	Ramp Run Slope LT (%)	4.6	Yes	Ramp Run Slope RT (%)	7.6
Yes	Ramp Cross Slope LT (%)	0.9	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	6.9		Crossing 2 Slope (%)	1
	Crossing 1 Cross Slope (%)	1.2		Crossing 2 Cross Slope (%)	2.7
Yes	Gutter Ponding	No	Yes	Curb Slope	2.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.8
Yes	Gutter Run Slope (%)	3.5		Road Cross Slope (%)	2.8
Yes	Gutter Cross Slope (%)	0.5	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No