# Access Compliance Report
# Public Rights-of-Way
# (Curb Ramps)

**Main Street: TRIAD_LN** | **Cross Street: ETON_PL** | **Location: NE**

**ADA ID: RPRK211028120727** | **Ramp Type: Type 4 - Parallel** | **Initial Pass/Fail: Fail** | **Overall Compliance: No** | **Severity Score: 2**

## Codes/Mitigation Info/Possible Solution

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

OC Std/PROW:

**R304.2.2, R204.3, R304.5.3, STD 1115**

Total Cost: **$ 4000**

| | | | |
|---|---|---|---|
| Parcel ID Number | **741-272-20** | Street 1 Name | **TRIAD_LN** |
| Ramp Island Or Median | **None** | Stop Condition-Street 1 | **NoControl** |
| Ramp Orientation | **Diag** | Street 2 Name | **ETON_PL** |
| Google Street View Link: | | Stop Condition-Street 2 | **NoControl** |

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54666657,-117.64653437

### Obstruction and Utility Measurement/Component Compliance

| Compliance | Description | Data | Compliance | Description | Data |
|---|---|---|---|---|---|
| **Yes** | Obstructions Present? | **No** | **N/A** | Utilities Present? | **No** |
| | Obstruction Types | **N/A** | | Utility Types | |
| | Obstruction Dimensions | **N/A** | | | **N/A** |

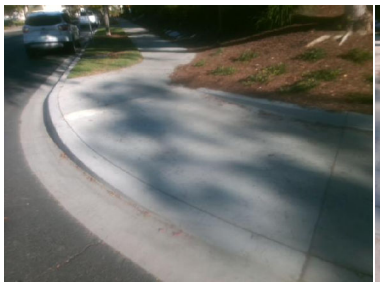
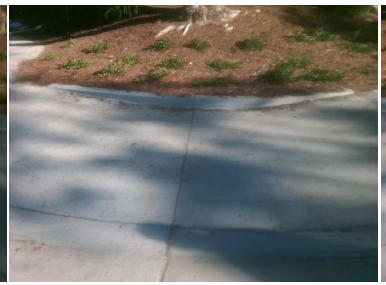
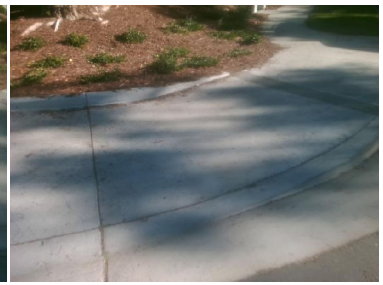

## Field Measurements/Component Compliance

| Compliance | Description | Data | Compliance | Description | Data |
|---|---|---|---|---|---|
| **N/A** | Ramp Length LT (in) | **127** | **N/A** | Ramp Length RT (in) | **116** |
| **Yes** | Ramp Width LT (in) | **89** | **Yes** | Ramp Width RT (in) | **88** |
| **Yes** | Ramp Run Slope LT (%) | **4.4** | **Yes** | Ramp Run Slope RT (%) | **2.2** |
| **Yes** | Ramp Cross Slope LT (%) | **1.2** | **No** | Ramp Cross Slope RT (%) | **3.5** |
| **N/A** | Landing Present | **N/A** | **N/A** | DWS Provided | **N/A** |
| **N/A** | Landing Length (in) | **N/A** | **N/A** | DWS Contrast | **N/A** |
| **N/A** | Landing Width (in) | **N/A** | **N/A** | DWS Length (in) | **N/A** |
| **N/A** | Landing Run Slope (%) | **N/A** | **N/A** | DWS Full Width | **N/A** |
| **N/A** | Landing Cross Slope (%) | **N/A** | | DWS Offset Type | **N/A** |
| **N/A** | Landing Movement Obstructed? | **N/A** | **N/A** | DWS Offset Left (in) | **N/A** |
| | Landing Movement Type | **N/A** | **N/A** | DWS Offset Right (in) | **N/A** |
| **N/A** | Landing Shared | **N/A** | | | |
| **N/A** | Clear Space | **Yes** | | | |
| **N/A** | Clear Space To Crosswalk (in) | **N/A** | | | |
| **N/A** | Marked Crosswalk 1 | **No** | **N/A** | Marked Crosswalk 2 | **No** |
| | Crossing 1 Direction | **W** | | Crossing 2 Direction | **S** |
| | Marked Crosswalk 1 Width (in) | **N/A** | | Marked Crosswalk 2 Width (in) | **N/A** |
| **N/A** | Ramp Inside Crosswalk 1 | **N/A** | **N/A** | Ramp Inside Crosswalk 2 | **N/A** |
| | Crossing 1 Slope (%) | **4** | | Crossing 2 Slope (%) | **0.2** |
| | Crossing 1 Cross Slope (%) | **1.6** | | Crossing 2 Cross Slope (%) | **0.8** |
| **N/A** | Gutter Ponding | **N/A** | **No** | Curb Slope | **10.3** |
| **Yes** | Gutter Lip Height (in) | **0** | | Road Run Slope (%) | **3** |
| **N/A** | Gutter Run Slope (%) | **N/A** | | Road Cross Slope (%) | **4.1** |
| **N/A** | Gutter Cross Slope (%) | **N/A** | **No** | Perpendicular Joint Present | **No** |
| **Yes** | Overall Surface Condition | **Acceptable** | | | |
| | Cross Gutter Present? | **No** | | Spandrel Present? | **No** |
| | Replace Cross Gutter? | **N/A** | | Replace Spandrel? | **N/A** |