Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

Main Street: IRVINE_BLVD | **Cross Street: TUSTIN_RANCH_RD** | **Location: SW**

ADA ID: RPRK220103131115 | **Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass** | **Overall Compliance: No** | **Severity Score: 0**

Codes/Mitigation Info/Possible Solution

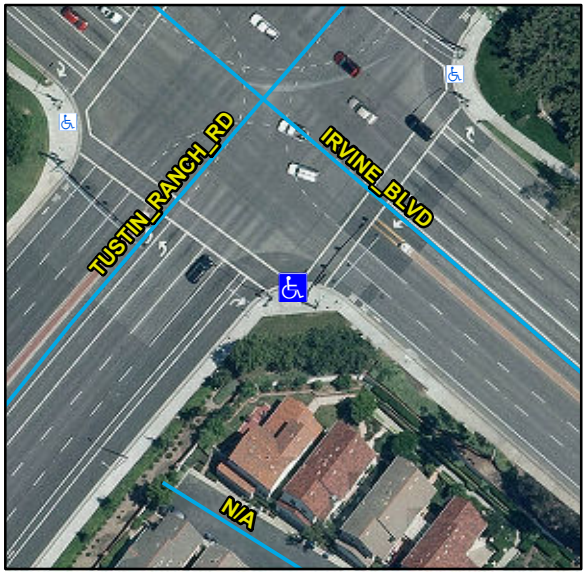

Possible Solutions:

Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

Total Cost: **$ 783**

Parcel ID Number	**500-341-75**	Street 1 Name	**IRVINE_BLVD**
Ramp Island Or Median	**None**	Stop Condition-Street 1	**Signal**
Ramp Orientation	**Diag**	Street 2 Name	**TUSTIN_RANCH_RD**
Google Street View Link:		Stop Condition-Street 2	**Signal**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.73734029,-117.79405091

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	**No**	**N/A**	Utilities Present?	**No**
	Obstruction Types	**N/A**		Utility Types	
	Obstruction Dimensions	**N/A**			**N/A**

Field Measurements/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	**118**	**N/A**	Flare Type LT	
Yes	Ramp Width (in)	**48**			**Sloped**
Yes	Ramp Run Slope (%)	**7.3**	**Yes**	Flare Slope LT (%)	**8.8**
Yes	Ramp Cross Slope (%)	**1.1**	**N/A**	Flare Traversable LT	**Yes**
N/A	Landing Present	**Yes**	**N/A**	Flare Type RT	
N/A	Landing Length (in)	**48**			**Sloped**
Yes	Landing Width (in)	**48**	**N/A**	Flare Slope RT (%)	**5**
No	Landing Run Slope (%)	**2.1**	**N/A**	Flare Traversable RT	**No**
Yes	Landing Cross Slope (%)	**1.4**	**Yes**	DWS Provided	**Yes**
N/A	Landing Movement Obstructed?	**No**	**Yes**	DWS Contrast	**Yes**
	Landing Movement Type	**N/A**	**Yes**	DWS Length (in)	**36**
N/A	Landing Shared	**No**	**Yes**	DWS Full Width	**Yes**
Yes	Clear Space	**Yes**	**Yes**	DWS Offset Left (in)	**0**
Yes	Clear Space To Crosswalk (in)	**48**	**Yes**	DWS Offset Right (in)	**N/A**
N/A	Marked Crosswalk 1	**Yes**	**N/A**	Marked Crosswalk 2	**Yes**
	Crossing 1 Direction	**NE**		Crossing 2 Direction	**NW**
	Marked Crosswalk 1 Width (in)	**144**		Marked Crosswalk 2 Width (in)	**144**
Yes	Ramp Inside Crosswalk 1	**Yes**	**Yes**	Ramp Inside Crosswalk 2	**Yes**
	Crossing 1 Slope (%)	**2.5**		Crossing 2 Slope (%)	**0.2**
	Crossing 1 Cross Slope (%)	**0.1**		Crossing 2 Cross Slope (%)	**1.5**
Yes	Gutter Ponding	**No**	**Yes**	Curb Slope	**2.4**
Yes	Gutter Lip Height (in)	**0**		Road Run Slope (%)	**1.9**
Yes	Gutter Run Slope (%)	**2.2**		Road Cross Slope (%)	**4.5**
No	Gutter Cross Slope (%)	**2.3**			
Yes	Overall Surface Condition:	**Acceptable**	**Yes**	Perp Joint Present	**Yes**
	Cross Gutter Present?	**No**		Spandrel Present?	**No**
	Replace Cross Gutter?	**N/A**		Replace Spandrel?	**N/A**