Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

Main Street: JUDY_ANNE_LN **Cross Street:** CHADBOURNE_LN **Location:** NE

ADA ID: RPRK220125134437 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 2

Codes/Mitigation Info/Possible Solution

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, STD 1115

Total Cost: **$ 4000**

Parcel ID Number	395-131-06	Street 1 Name	JUDY_ANNE_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	CHADBOURNE_LN
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76163278,-117.80242292

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

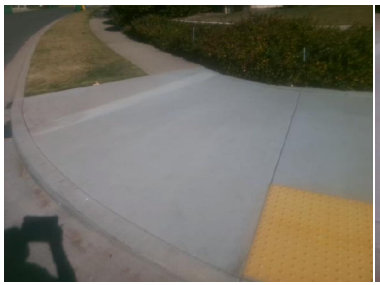

Field Measurements/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	110	N/A	Ramp Length RT (in)	89
Yes	Ramp Width LT (in)	134	Yes	Ramp Width RT (in)	134
Yes	Ramp Run Slope LT (%)	2.8	Yes	Ramp Run Slope RT (%)	5.1
No	Ramp Cross Slope LT (%)	4.2	No	Ramp Cross Slope RT (%)	4.4
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.8		Crossing 2 Slope (%)	3.6
	Crossing 1 Cross Slope (%)	0.7		Crossing 2 Cross Slope (%)	0.8
N/A	Gutter Ponding	N/A	N/A	Curb Slope	2.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	1.9
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No