
Bridge Inspection Records Information System

The requested documents have been generated by the BIRIS.

The documents provided are considered confidential and may only be released outside of the department of transportation upon proper execution of the confidentiality agreement.

State of California
Department of Transportation

**Division of Maintenance
Structures Maintenance & Investigations**



DEPARTMENT OF TRANSPORTATION
Structure Maintenance & Investigations

Bridge Number : 55C0573
Facility Carried: RIVERFORD RD
Location : 0.1 MI NW BROWNING AV
City :
Inspection Date : 24-JUL-01
Inspection Type
Routine Group A Underwater Special Other
X

Bridge Inspection Report

Name : REDHILL CHANNEL

CONSTRUCTION INFORMATION

Year Built : Unknown
Year Widened : 1989
Length (m) : 6.7

Skew (degrees): 0
No. of Joints : 0
No. of Hinges : 0

Description of Structure : Double 3.7 m W and 2.6 m W x 2.4 m H x 14.3 m L RC box culvert (grade top) beneath 0.6 m of earth fill.

Span Configuration : (W) 2.6 m, 3.7 m (E) clear, normal

LOAD CAPACITY AND RATINGS

Design Live Load : MS - 18 OR HS - 20

Inventory Rating : 32.6 metric tons

Operating Rating : 53.5 metric tons

Permit Rating : PPPPP

Posting Load : Type 3 N/A english tons

Calculation Method : LOAD FACTOR

Calculation Method : LOAD FACTOR

Type 3S2 N/A english tons Type 3-3 N/A english tons

DESCRIPTION ON STRUCTURE

Bridge width : (S) 0.2 m br, 1.2 m sw, 11.0 m, 1.2 m sw, 0.2 m br (N)

Total Width : 14.3 m

Net Width : 11.0 m

Rail Description : Masonry

Min. Vertical Clearance : Unimpaired

No. of Lanes : 2

Rail Code : 0000

DESCRIPTION UNDER STRUCTURE

Channel Description : RC rectangular.

CONDITION OF STRUCTURE

The structure is in good condition.

MISCELLANEOUS

Vehicular access into the channel is via the Irvine-El Modena Channel at the northeast quadrant of RedHill Avenue or at the northeast quadrant of Park Center Drive.

ELEMENT LEVEL INSPECTION RATINGS

F#	Elem	Element Description	Env	Total Units	Qty in each Condition State				
No.				Quantity	St. 1	St. 2	St. 3	St. 4	St. 5
01 241		Reinforced Concrete Culvert	2	14 m.	14	0	0	0	0
01 339		Concrete Railing (aesthetic/masonry)	2	38 m.	38	0	0	0	0

WORK RECOMMENDATIONS - NONE

Bridge No.: 55C0573

Location: 0.1 MI NW BROWNING AV

Inspection Date: 24-JUL-01

Inspected By : M. Ogata

M. Ogata
Registered Civil Engineer



CC : TMRut
Orange County

Bridge No.: 55C0573

Location: 0.1 MI NW BROWNING AV

Inspection Date: 24-JUL-01

STRUCTURE INVENTORY AND APPRAISAL REPORT

***** IDENTIFICATION *****

(1) STATE NAME - CALIFORNIA 069
 (8) STRUCTURE NUMBER 55C0573
 (5) INVENTORY ROUTE (ON/UNDER) - ON 1 40 00000N
 (2) HIGHWAY AGENCY DISTRICT 12
 (3) COUNTY CODE 059 (4) PLACE CODE 00000
 (6) FEATURE INTERSECTED - REDHILL CHANNEL
 (7) FACILITY CARRIED - RIVERFORD RD
 (9) LOCATION - 0.1 MI NW BROWNING AV
 (11) MILEPOINT/KILOMETERPOINT 0
 (12) BASE HIGHWAY NETWORK - NOT ON NET 0
 (13) LRS INVENTORY ROUTE & SUBROUTE
 (16) LATITUDE 33 DEG 44 MIN 16 SEC
 (17) LONGITUDE 117 DEG 48 MIN 10 SEC
 (98) BORDER BRIDGE STATE CODE % SHARE %
 (99) BORDER BRIDGE STRUCTURE NUMBER

***** STRUCTURE TYPE AND MATERIAL *****

(43) STRUCTURE TYPE MAIN: MATERIAL - CONCRETE
 TYPE - CULVERT CODE 1 19
 (44) STRUCTURE TYPE APPR: MATERIAL -
 TYPE - CODE
 (45) NUMBER OF SPANS IN MAIN UNIT 2
 (46) NUMBER OF APPROACH SPANS 0
 (107) DECK STRUCTURE TYPE NOT APPLICABLE CODE N
 (108) WEARING SURFACE / PROTECTIVE SYSTEM:
 A) TYPE OF WEARING SURFACE - NOT APPLICABLE CODE N
 B) TYPE OF MEMBRANE - NOT APPLICABLE CODE N
 C) TYPE OF DECK PROTECTION - NOT APPLICABLE CODE N

***** AGE AND SERVICE *****

(27) YEAR BUILT
 (106) YEAR RECONSTRUCTED 1989
 (42) TYPE OF SERVICE: ON - HIGHWAY-PEDESTRIAN 5
 UNDER - WATERWAY 5
 (28) LANES: ON STRUCTURE 02 UNDER STRUCTURE
 (29) AVERAGE DAILY TRAFFIC 500
 (30) YEAR OF ADT 1998 (109) TRUCK ADT 1%
 (19) BYPASS, DETOUR LENGTH 2 KM

***** GEOMETRIC DATA *****

(48) LENGTH OF MAXIMUM SPAN 3.7 M
 (49) STRUCTURE LENGTH 6.7 M
 (50) CURB OR SIDEWALK: LEFT 1.2 M RIGHT 1.2 M
 (51) BRIDGE ROADWAY WIDTH CURB TO CURB 11 M
 (52) DECK WIDTH OUT TO OUT 14.3 M
 (32) APPROACH ROADWAY WIDTH (W/SHOULDERS) 11 M
 (33) BRIDGE MEDIAN - CLOSED (NO BARRIER) 2
 (34) SKEW 0 DEG (35) STRUCTURE FLARED NO
 (10) INVENTORY ROUTE MIN VERT CLEAR 99.99 M
 (47) INVENTORY ROUTE TOTAL HORIZ CLEAR 11 M
 (53) MIN VERT CLEAR OVER BRIDGE RDWY 99.99 M
 (54) MIN VERT UNDERCLEAR REF - NOT H/RR 0 M
 (55) MIN LAT UNDERCLEAR RT REF - NOT H/RR 0 M
 (56) MIN LAT UNDERCLEAR LT 0 M

***** NAVIGATION DATA *****

(38) NAVIGATION CONTROL - NOT APPLICABLE CODE N
 (111) PIER PROTECTION - NOT REQUIRED CODE 1
 (39) NAVIGATION VERTICAL CLEARANCE 0 M
 (116) VERT-LIFT BRIDGE NAV MIN VERT CLEAR 0 M
 (40) NAVIGATION HORIZONTAL CLEARANCE 0

***** SUFFICIENCY RATING = 97.0 *****

STATUS =

HEALTH INDEX = 100

***** CLASSIFICATION ***** CODE

(112) NBIS BRIDGE LENGTH - YES Y
 (104) HIGHWAY SYSTEM - NOT ON NHS 0
 (26) FUNCTIONAL CLASS - LOCAL URBAN 19
 (100) DEFENSE HIGHWAY - NOT STRAHNET 0
 (101) PARALLEL STRUCTURE - NONE EXISTS N
 (102) DIRECTION OF TRAFFIC - 2 WAY 2
 (103) TEMPORARY STRUCTURE -
 (105) FEDERAL LANDS HIGHWAY - NOT APPLICABLE 0
 (110) DESIGNATED NATIONAL NETWORK - NOT ON NET 0
 (20) TOLL - ON FREE ROAD 3
 (21) MAINTAIN - COUNTY HIGHWAY AGENCY 2
 (22) OWNER - COUNTY HIGHWAY AGENCY 2
 (37) HISTORICAL SIGNIFICANCE - NOT ELIGIBLE 5

***** CONDITION ***** CODE

(58) DECK N
 (59) SUPERSTRUCTURE N
 (60) SUBSTRUCTURE N
 (61) CHANNEL & CHANNEL PROTECTION 9
 (62) CULVERTS 8

***** LOAD RATING AND POSTING ***** CODE

(31) DESIGN LOAD - MS - 18 OR HS - 20 5
 (63) OPERATING RATING METHOD - LOAD FACTOR 1
 (64) OPERATING RATING - 53.5
 (65) INVENTORY RATING METHOD - LOAD FACTOR 1
 (66) INVENTORY RATING - 32.6
 (70) BRIDGE POSTING - Equal to or above legal loads 5
 (41) STRUCTURE OPEN, POSTED OR CLOSED - A
 DESCRIPTION - OPEN, NO RESTRICTION

***** APPRAISAL ***** CODE

(67) STRUCTURAL EVALUATION 8
 (68) DECK GEOMETRY 7
 (69) UNDERCLEARANCES, VERTICAL & HORIZONTAL N
 (71) WATER ADEQUACY 9
 (72) APPROACH ROADWAY ALIGNMENT 8
 (36) TRAFFIC SAFETY FEATURES 0000
 (113) SCOUR CRITICAL BRIDGES 8

***** PROPOSED IMPROVEMENTS *****

(75) TYPE OF WORK - CODE
 (76) LENGTH OF STRUCTURE IMPROVEMENT M
 (94) BRIDGE IMPROVEMENT COST
 (95) ROADWAY IMPROVEMENT COST
 (96) TOTAL PROJECT COST
 (97) YEAR OF IMPROVEMENT COST ESTIMATE
 (114) FUTURE ADT 500
 (115) YEAR OF FUTURE ADT 2015

***** INSPECTIONS *****

(90) INSPECTION DATE 07/01 (91) FREQUENCY 24 MO
 (92) CRITICAL FEATURE INSPECTION: (93) CFI DATE
 A) FRACTURE CRIT DETAIL - NO -1 MO A)
 B) UNDERWATER INSP - NO -1 MO B)
 C) OTHER SPECIAL INSP - NO -1 MO C)

Bridge Number 55C-573

Location 12 - Ora - CR
Dist.-Co.-Rte.-City

Date of Investigation August 1, 1996

TYPE OF INVESTIGATION/REPORT

BIENNIAL	<u>X</u>	DAMAGE	___
CATEGORY A	___	OTHER	___
UNDERWATER	___	OFFICE	___

Name REDHILL CHANNEL (Riverford Road, 0.1 mile northwest of Browning Avenue)

CONDITION RATINGS:

Element Level Inspection (ELI) form attached.

Channel & Channel Protection

9

CONDITION OF STRUCTURE:

Condition of structure is good.

WORK RECOMMENDED:

None.

M. Hadi Behrooj *MHB*

By

G. P. Balinghasay
G. P. Balinghasay



GPB:cd
cc: TMRut
Orange County

SUPPLEMENTARY BRIDGE REPORT

DS-M19 (REV. 2/93)

Bridge Number 55C-573

Location 12 - Ora - CR
Dist.-Co.-Rte.-City

Date of Investigation June 29, 1994

TYPE OF INVESTIGATION/REPORT

BIENNIAL	<u>X</u>	DAMAGE	___
CATEGORY A	___	OTHER	___
UNDERWATER	___	OFFICE	___

Name REDHILL CHANNEL (Riverford Road, 0.1 mile northwest of Browning Avenue)

CONDITION RATINGS:

Condition ratings of all bridge elements are shown on the PONTIS DATA FORM (Attachment A).

Channel & Channel Protection

9

SCOUR CRITICAL:

The scour rating of A-1 is appropriate.

CONDITION OF STRUCTURE:

Otherwise the structure is in good condition.

WORK RECOMMENDED:

None.


M. H. Behrooj *MHB*

By

S. A. Zanganeh
S. A. Zanganeh

SAZ:cd

cc: CDHarris
Orange County
WLindsey

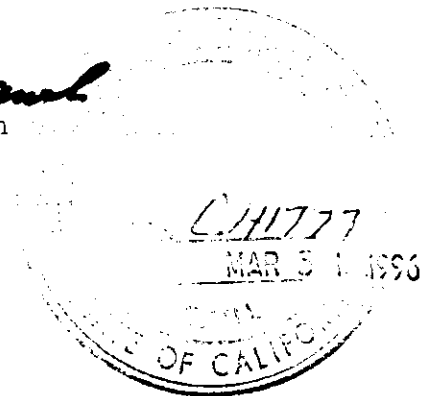

INFORMATION ONLY - NOT FOR UPDATE

BRIDGE NUMBER	FRAME	INSPECTION DATE
55C0573	01	062994
1 8	9	11 16

SCOUR CRITICAL	NO
CATEGORY A	NO
FRACTURE CRITICAL	NO
ELIGIBLE FOR RAIL UPGRADE	NO
UNDERWATER INSPECTION	NO

DISTRICT	12
COUNTY	ORA
ROUTE	
POSTMILE	
NAME	

[illegible]

BY: Sgt

SUPPLEMENTARY BRIDGE REPORT
DS-M19 (REV. 12/91)

Bridge Number 55C-573

Location 12 - Ora - CR
Dist.-Co.-Rte.-City

Date of Investigation June 15, 1992

TYPE OF INVESTIGATION/REPORT

BIENNIAL X DAMAGE
CATEGORY A OTHER
UNDERWATER OFFICE

Name REDHILL CHANNEL (Riverford Road, 0.1 mile northwest of Browning Avenue)

CONDITION RATINGS:

Deck

N

Superstructure

N

Substructure

N

Channel & Channel Protection


9

Culvert

8

CONDITION OF STRUCTURE:

Condition of the structure is good.

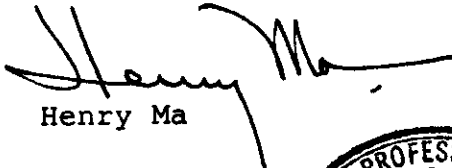
Henry Ma

HM:cd

cc: INagai (2)
County of Orange



BRIDGE REPORT

DS-M58 (REV. 4/90)

14W12

Bridge No. 55C - 573

Location 12 - Ora - CR
Dist Co Rte City

Date of Investigation May 29, 1990

Name REDHILL CHANNEL (Riverford Road, 0.1 mile northwest of Browning Avenue)

Lat. 33° - 44.3'N Long. 117° - 48.1'W

Custodian County of Orange Owner County of Orange

STRUCTURAL DATA AND HISTORY

Year Built Unknown By Orange County Contract No. Unknown
See Page 2

Designed by: Plans Avail. @ County

Description: Double 47' long RC box culvert (12' x 8' and 8.5' x 8')
(grade top culvert) on spread footing under 2'± of fill
and AC surfacing.

Spans (W) 8' clear; 12' clear (E)

Length 22.2' NBIS Bridge Length Yes Skew None

Number Of Intermediate Joints: @Hinges N @Bents N

Maximum Column/Pier Height: (Less than 20') X (20'-29') (30' & Over)

Design Live Load HS20-44 Design Method Unknown

DESCRIPTION - ON STRUCTURE

Bridge Width (S) 0.7'br; 4'sw; 36'; 4'sw; 0.7'br (N)

Total Width 47' Net Width 36' Lanes 2 Tracks None

Median None Rail Type Masonry block with steel picket fence 0000

Vert. Clearance over deck Unimpaired Appr. Rdwy. Width 36'

Deck Type N Wearing Surface/Prot. Sys. NNN

Alignment Tangent

DESCRIPTION - UNDER STRUCTURE

Roadway Section None

Clearances: Road: Vert. Horiz. Lt. ; Rt.

Lanes Tracks

Facilities Crossed Redhill Channel (F13)

May 29, 1990

DESCRIPTION - HYDRAULICS

Channel RC rectangular

Navigable: Yes ☐ No ☒ Clearances: Vert.

Horiz.

Pier/Abutment Protection (For Navigation) ☐

TRAFFIC INFORMATION

	DECK	YEAR	UNDER	YEAR
Average Daily Traffic & Year :	500 Est	1990	N	
Average Daily Traffic (Future) :	500 Est	2010	N	
Average Daily Trucks (% OF ADT) :	1% Est		N	
Bypass Detour Length	1 mile		N	
Shell Route:	No		N	
Functional Classification :	19		N	
LOAD RATINGS:	Inventory HS 20	Operating HS 33		
	Permit P P P P P	Computation Method Assigned		

CONDITION RATINGS:

Deck	N	Superstructure	N	Substructure	N
Channel & Channel Protection	9	Culvert	8	Widenable	Yes

APPRAISAL RATINGS:

Waterway Adequacy	9	Approach Roadway Alignment	8
-------------------	---	----------------------------	---

Date of Revisions

STRUCTURAL DATA AND HISTORY (Con't.)

Date of Revision: 1989, added one 8.5' x 8' RC box culvert to west side of the existing single 12' x 8' RC box culvert.

CONDITION OF STRUCTURE:

Condition of the structure is good.

Henry Ma



HM:ms

cc: INagai (2)

County of Orange