


Access Compliance Report - Public Rights-of-Way (Corridor: Sidewalk & Intersection Items)

Corridor ID: CERRITOS_AVE_007



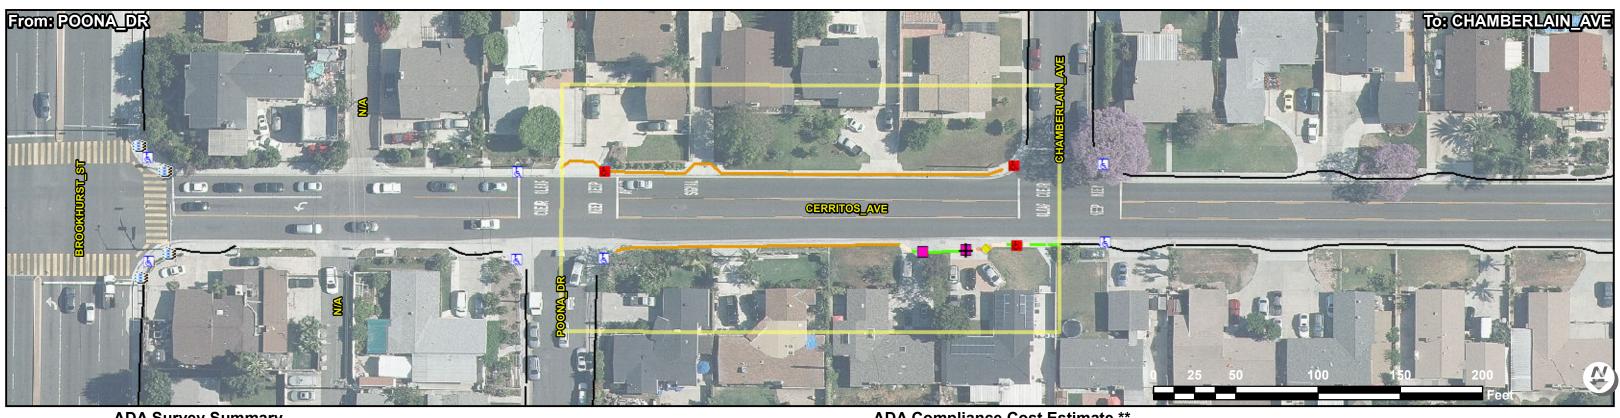

ADA Survey Summary

	ADA Gui vey Guillillai y				
Item	Description	Qua	Quantity		
1	Vertical Displacement <= 1"	1	EA		
2	Vertical Displacement > 1"	0	EA		
2 3 4 5 6 7 8	Uneven Vertical Displacement	0	EA		
4	Horizontal Opening > 0.5"	0	EA		
5	Poor Surface Condition	0	SY		
6	Utility Obstruction	0	EA		
7	Power Pole Obstruction	0	EA		
8	Traffic Signal Obstruction	0	EΑ		
9	Sign Obstruction	0	EA		
10	Low Vegetative Obstruction	0	EA		
11	Overhead Vegetative Obstruction	0	EA		
12	Other Obstruction*	0	EA		
13	Miscellaneous Obstruction	0	EA		
14	Temp/Private Obstruction	0	EA		
15	Commercial Driveway	0	LF		
16	Residential Driveway	33	LF		
<u>17</u>	Total Sidewalk Length Assessed	97	LF		
18	Average Sidewalk Width	54	IN		
19	Curb Ramps In Corridor	3	EA		
20	Island Curb Cuts In Corridor	0	EA		
21	Signal Push Buttons In Corridor	0	<u>EA</u>		
22	Accessible Parking Spaces In Corridor	0	EA		
23	Missing Sidewalk/Gaps in Connectivity	0	LF		
24	Buried/Narrow Sidewalk	0	LF		
25	Sidewalk Not Surveyed	0	LF		
26	No Sidewalk Observed	0	LF		
27	Corridor Severity Score	5.39			

Inventory Symbology

Running Slope (Aligned, Not Costed)

5.1 - 8.3%8.4 - 10.0% 10.1 - 12.5% 12.5%+

Collection in Adjacent Corridors

Curb Ramps Island Curb Cuts

> Signal Push Buttons Sidewalk Collection

ADA Compliance Cost Estimate ** Quantity Unit Unit Price

Item	Description G	Quantity l	Jnit	Unit Price	Item Cost	
1	Vertical Displacement <= 1"	0	EΑ	\$150.00	\$ 0.00	
2	Vertical Displacement > 1"	0	EΑ	\$2125.00	\$ 0.00	
3	Uneven Vertical Displacement	0	EΑ	\$2125.00	\$ 0.00	
4	Horizontal Opening > 0.5"	0	EΑ	\$1062.00	\$ 0.00	
5	Poor Surface Condition	0	SY	\$255.50	\$ 0.00	
6	Utility Obstruction	0	EΑ	\$5000.00	\$ 0.00	
7	Power Pole Obstruction	0	EΑ	\$20000.00	\$ 0.00	
8	Traffic Signal Obstruction	0	EΑ	\$5000.00	\$ 0.00	
9	Sign Obstruction	0	EΑ	\$2000.00	\$ 0.00	
10	Low Vegetative Obstruction	0	EΑ	\$200.00	\$ 0.00	
11	Overhead Vegetative Obstruction	0	EΑ	\$400.00	\$ 0.00	
12	Other Obstruction*	0	EΑ	\$2000.00	\$ 0.00	
13	Miscellaneous Obstruction	0	EΑ	\$2000.00	\$ 0.00	
14	Commercial Driveway	0	LF	\$118.00	\$ 0.00	
15	Residential Driveway	17	LF	\$118.00	\$ 2098.00	
16	Running Slope Violation	0	SY	\$255.50	\$ 0.00	
<u>17</u>	Cross Slope Violation	11	SY	\$255.50	\$ 2961.00	
18	Running and Cross Slope violations	0	SY	\$255.50	\$ 0.00	
19	Non-Compliant Curb Ramps and Total Cost*	3	EΑ	VARIES	\$ 6943.00	
20	Non-Compliant Island Curb Cuts and Total Cost*	0	EΑ	VARIES	\$ 0.00	٠
21	Non-Compliant Signal Push Buttons Cuts and Total	al Cost* 0	EΑ	VARIES	\$ 0.00	٠
22	Non-Compliant Accessible Parking Spaces and To	tal Cost* 0	EΑ	VARIES	\$ 0.00	
23	Missing Sidewalk/Gap in Connectivity	0	SY	\$150.00	\$ 0.00	
24	Buried/Narrow Sidewalk	0	SY	\$255.50	\$ 0.00	
	-			Total:	\$ \$43,869.00	

Compliance Symbology

Compliant Curb Ramp

Non-Compliant Curb Ramp

Compliant Island Curb Cut

Non-Compliant Island Curb Cut

Compliant Signal

Non-Compliant Signal

Cross Slope

2.01 - 3.0% 3.01 - 4.0% 4.01 - 5.0%

5.01%+

Running Slope

(Deviated, Costed)

5.1 - 8.3%8.4 - 10.0%

10.1 - 12.5%

12.5%+

*Note: Some items combined for display. See Unit Cost Table for specific unit costs for each type of obstruction, curb ramp, island curb cut. Missing sidewalk/gaps in connectivity reported together in compliance report and are separate in the GIS layers."

**Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.