




Access Compliance Report - Public Rights-of-Way
(Corridor: Sidewalk & Intersection Items)

Corridor ID: ESENCIA_DR_013

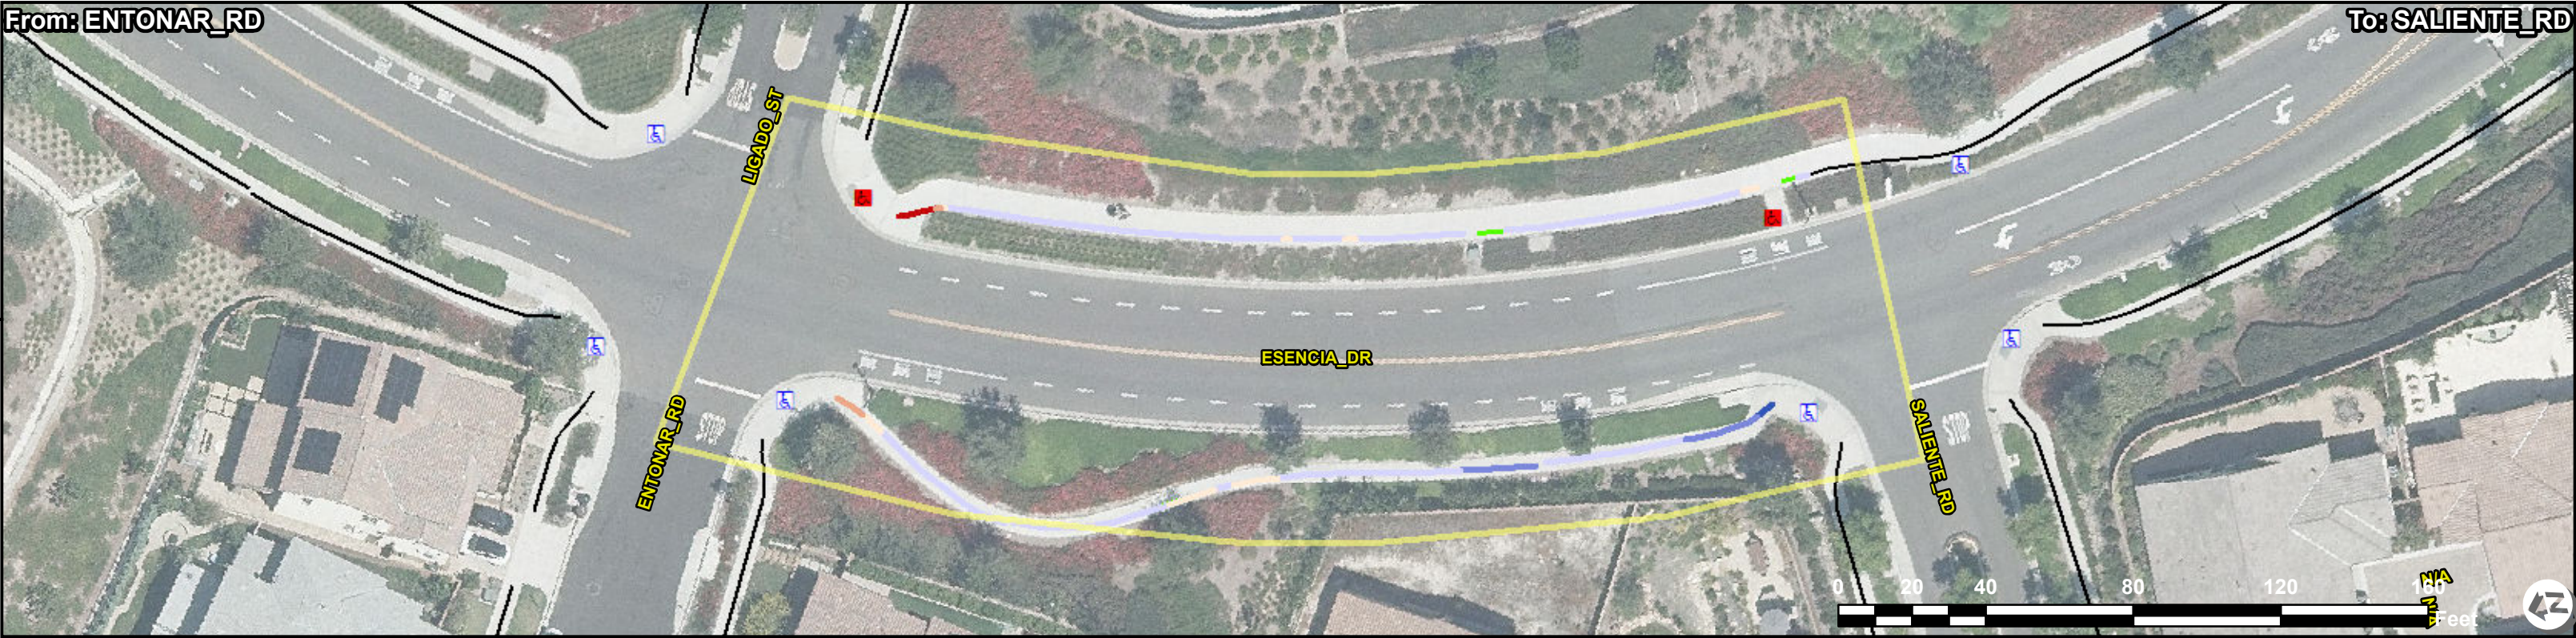

ADA Survey Summary

Item	Description	Quantity
1	Vertical Displacement <= 1"	0 EA
2	Vertical Displacement > 1"	0 EA
3	Uneven Vertical Displacement	0 EA
4	Horizontal Opening > 0.5"	0 EA
5	Poor Surface Condition	0 SY
6	Utility Obstruction	0 EA
7	Power Pole Obstruction	0 EA
8	Traffic Signal Obstruction	0 EA
9	Sign Obstruction	0 EA
10	Low Vegetative Obstruction	0 EA
11	Overhead Vegetative Obstruction	0 EA
12	Other Obstruction*	0 EA
13	Miscellaneous Obstruction	0 EA
14	Temp/Private Obstruction	0 EA
15	Commercial Driveway	0 LF
16	Residential Driveway	0 LF
17	Total Sidewalk Length Assessed	504 LF
18	Average Sidewalk Width	78 IN
19	Curb Ramps In Corridor	2 EA
20	Island Curb Cuts In Corridor	0 EA
21	Signal Push Buttons In Corridor	0 EA
22	Accessible Parking Spaces In Corridor	0 EA
23	Missing Sidewalk/Gaps in Connectivity	0 LF
24	Buried/Narrow Sidewalk	0 LF
25	Sidewalk Not Surveyed	0 LF
26	No Sidewalk Observed	0 LF
27	Corridor Severity Score	13.28

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53675382,-117.6032998

Inventory Symbology

◆	Running Slope
◆	(Aligned, Not Costed)
◆	5.1 – 8.3%
◆	8.4 – 10.0%
◆	10.1 – 12.5%
◆	12.5%+
●	Collection in Adjacent Corridors
●	● Curb Ramps
●	● Island Curb Cuts
●	● Signal Push Buttons
—	— Sidewalk Collection

ADA Compliance Cost Estimate **

Item	Description	Quantity	Unit	Unit Price	Item Cost
1	Vertical Displacement <= 1"	0	EA	\$150.00	\$ 0.00
2	Vertical Displacement > 1"	0	EA	\$2125.00	\$ 0.00
3	Uneven Vertical Displacement	0	EA	\$2125.00	\$ 0.00
4	Horizontal Opening > 0.5"	0	EA	\$1062.00	\$ 0.00
5	Poor Surface Condition	0	SY	\$255.50	\$ 0.00
6	Utility Obstruction	0	EA	\$5000.00	\$ 0.00
7	Power Pole Obstruction	0	EA	\$20000.00	\$ 0.00
8	Traffic Signal Obstruction	0	EA	\$5000.00	\$ 0.00
9	Sign Obstruction	0	EA	\$2000.00	\$ 0.00
10	Low Vegetative Obstruction	0	EA	\$200.00	\$ 0.00
11	Overhead Vegetative Obstruction	0	EA	\$400.00	\$ 0.00
12	Other Obstruction*	0	EA	\$2000.00	\$ 0.00
13	Miscellaneous Obstruction	0	EA	\$2000.00	\$ 0.00
14	Commercial Driveway	0	LF	\$118.00	\$ 0.00
15	Residential Driveway	0	LF	\$118.00	\$ 0.00
16	Running Slope Violation	0	SY	\$255.50	\$ 0.00
17	Cross Slope Violation	6	SY	\$255.50	\$ 1680.00
18	Running and Cross Slope violations	36	SY	\$255.50	\$ 9212.00
19	Non-Compliant Curb Ramps and Total Cost*	2	EA	VARIES	\$ 7332.00
20	Non-Compliant Island Curb Cuts and Total Cost*	0	EA	VARIES	\$ 0.00
21	Non-Compliant Signal Push Buttons Cuts and Total Cost*	0	EA	VARIES	\$ 0.00
22	Non-Compliant Accessible Parking Spaces and Total Cost*	0	EA	VARIES	\$ 0.00
23	Missing Sidewalk/Gap in Connectivity	0	SY	\$150.00	\$ 0.00
24	Buried/Narrow Sidewalk	0	SY	\$255.50	\$ 0.00

Total: \$ \$18,225.00

Compliance Symbology

◆	Compliant Curb Ramp
◆	Non-Compliant Curb Ramp
◆	Compliant Island Curb Cut
◆	Non-Compliant Island Curb Cut
◆	Compliant Signal
◆	Non-Compliant Signal
●	Cross Slope
●	2.01 - 3.0%
●	3.01 - 4.0%
●	4.01 - 5.0%
●	5.01%+
—	Running Slope
—	(Deviated, Costed)
—	5.1 – 8.3%
—	8.4 – 10.0%
—	10.1 – 12.5%
—	12.5%+

Note: Some items combined for display. See Unit Cost Table for specific unit costs for each type of obstruction, curb ramp, island curb cut. Missing sidewalk/gaps in connectivity reported together in compliance report and are separate in the GIS layers.

**Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.