




Access Compliance Report - Public Rights-of-Way  
(Corridor: Sidewalk & Intersection Items)

Corridor ID: MARBLE\_ARCH\_DR\_001

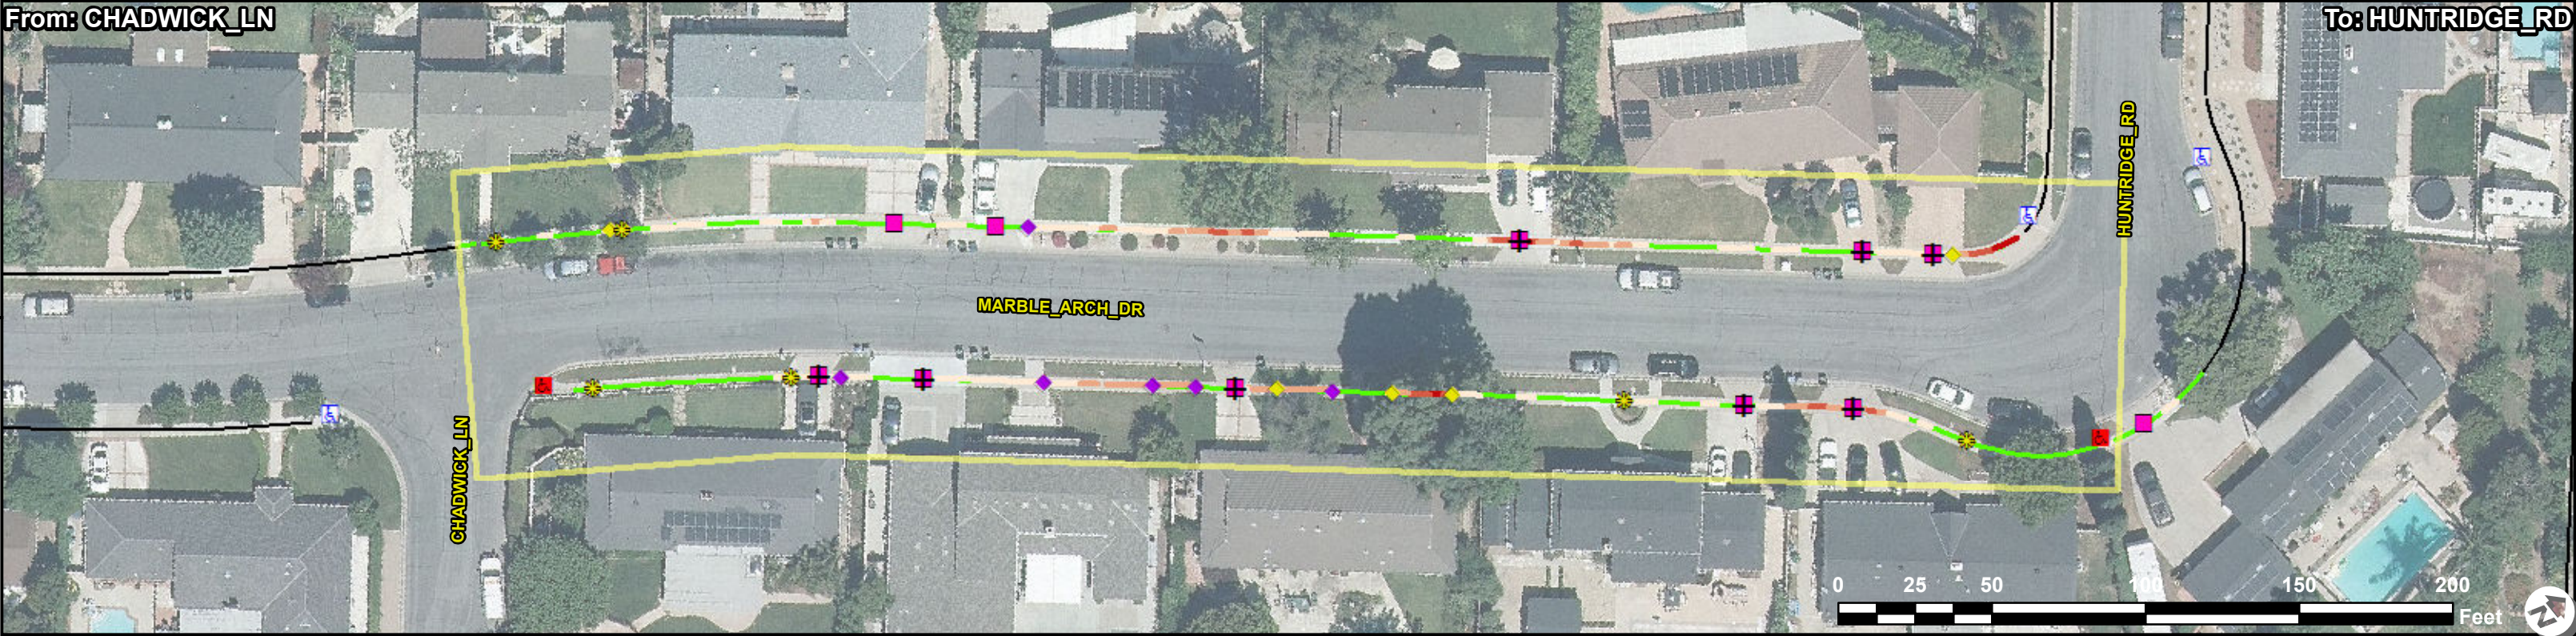

ADA Survey Summary

| Item | Description                           | Quantity | EA | SY | LF | IN |
|------|---------------------------------------|----------|----|----|----|----|
| 1    | Vertical Displacement <= 1"           | 11       | EA |    |    |    |
| 2    | Vertical Displacement > 1"            | 0        | EA |    |    |    |
| 3    | Uneven Vertical Displacement          | 0        | EA |    |    |    |
| 4    | Horizontal Opening > 0.5"             | 6        | EA |    |    |    |
| 5    | Poor Surface Condition                | 0        | SY |    |    |    |
| 6    | Utility Obstruction                   | 0        | EA |    |    |    |
| 7    | Power Pole Obstruction                | 0        | EA |    |    |    |
| 8    | Traffic Signal Obstruction            | 0        | EA |    |    |    |
| 9    | Sign Obstruction                      | 0        | EA |    |    |    |
| 10   | Low Vegetative Obstruction            | 0        | EA |    |    |    |
| 11   | Overhead Vegetative Obstruction       | 0        | EA |    |    |    |
| 12   | Other Obstruction*                    | 0        | EA |    |    |    |
| 13   | Miscellaneous Obstruction             | 0        | EA |    |    |    |
| 14   | Temp/Private Obstruction              | 0        | EA |    |    |    |
| 15   | Commercial Driveway                   | 0        | LF |    |    |    |
| 16   | Residential Driveway                  | 130      | LF |    |    |    |
| 17   | Total Sidewalk Length Assessed        | 1042     | LF |    |    |    |
| 18   | Average Sidewalk Width                | 48       | IN |    |    |    |
| 19   | Curb Ramps In Corridor                | 2        | EA |    |    |    |
| 20   | Island Curb Cuts In Corridor          | 0        | EA |    |    |    |
| 21   | Signal Push Buttons In Corridor       | 0        | EA |    |    |    |
| 22   | Accessible Parking Spaces In Corridor | 0        | EA |    |    |    |
| 23   | Missing Sidewalk/Gaps in Connectivity | 0        | LF |    |    |    |
| 24   | Buried/Narrow Sidewalk                | 0        | LF |    |    |    |
| 25   | Sidewalk Not Surveyed                 | 0        | LF |    |    |    |
| 26   | No Sidewalk Observed                  | 0        | LF |    |    |    |
| 27   | Corridor Severity Score               | 102.65   |    |    |    |    |

Google Street View Link

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.76067455,-117.79558996](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76067455,-117.79558996)

ADA Compliance Cost Estimate \*\*

| Item   | Description                                             | Quantity | Unit | Unit Price | Item Cost   |
|--------|---------------------------------------------------------|----------|------|------------|-------------|
| 1      | Vertical Displacement <= 1"                             | 6        | EA   | \$150.00   | \$ 900.00   |
| 2      | Vertical Displacement > 1"                              | 0        | EA   | \$2125.00  | \$ 0.00     |
| 3      | Uneven Vertical Displacement                            | 0        | EA   | \$2125.00  | \$ 0.00     |
| 4      | Horizontal Opening > 0.5"                               | 0        | EA   | \$1062.00  | \$ 0.00     |
| 5      | Poor Surface Condition                                  | 0        | SY   | \$255.50   | \$ 0.00     |
| 6      | Utility Obstruction                                     | 0        | EA   | \$5000.00  | \$ 0.00     |
| 7      | Power Pole Obstruction                                  | 0        | EA   | \$20000.00 | \$ 0.00     |
| 8      | Traffic Signal Obstruction                              | 0        | EA   | \$5000.00  | \$ 0.00     |
| 9      | Sign Obstruction                                        | 0        | EA   | \$2000.00  | \$ 0.00     |
| 10     | Low Vegetative Obstruction                              | 0        | EA   | \$200.00   | \$ 0.00     |
| 11     | Overhead Vegetative Obstruction                         | 0        | EA   | \$400.00   | \$ 0.00     |
| 12     | Other Obstruction*                                      | 0        | EA   | \$2000.00  | \$ 0.00     |
| 13     | Miscellaneous Obstruction                               | 0        | EA   | \$2000.00  | \$ 0.00     |
| 14     | Commercial Driveway                                     | 0        | LF   | \$118.00   | \$ 0.00     |
| 15     | Residential Driveway                                    | 100      | LF   | \$118.00   | \$ 11855.00 |
| 16     | Running Slope Violation                                 | 0        | SY   | \$255.50   | \$ 0.00     |
| 17     | Cross Slope Violation                                   | 204      | SY   | \$255.50   | \$ 52336.00 |
| 18     | Running and Cross Slope violations                      | 0        | SY   | \$255.50   | \$ 0.00     |
| 19     | Non-Compliant Curb Ramps and Total Cost*                | 2        | EA   | VARIES     | \$ 6412.00  |
| 20     | Non-Compliant Island Curb Cuts and Total Cost*          | 0        | EA   | VARIES     | \$ 0.00     |
| 21     | Non-Compliant Signal Push Buttons Cuts and Total Cost*  | 0        | EA   | VARIES     | \$ 0.00     |
| 22     | Non-Compliant Accessible Parking Spaces and Total Cost* | 0        | EA   | VARIES     | \$ 0.00     |
| 23     | Missing Sidewalk/Gap in Connectivity                    | 0        | SY   | \$150.00   | \$ 0.00     |
| 24     | Buried/Narrow Sidewalk                                  | 0        | SY   | \$255.50   | \$ 0.00     |
| Total: |                                                         |          |      | \$         | \$71,504.00 |

| Compliance Symbology                |                               |
|-------------------------------------|-------------------------------|
|                                     | Compliant Curb Ramp           |
|                                     | Non-Compliant Curb Ramp       |
|                                     | Compliant Island Curb Cut     |
|                                     | Non-Compliant Island Curb Cut |
|                                     | Compliant Signal              |
|                                     | Non-Compliant Signal          |
| Cross Slope                         |                               |
|                                     | 2.01 - 3.0%                   |
|                                     | 3.01 - 4.0%                   |
|                                     | 4.01 - 5.0%                   |
|                                     | 5.01%+                        |
| Running Slope<br>(Deviated, Costed) |                               |
|                                     | 5.1 - 8.3%                    |
|                                     | 8.4 - 10.0%                   |
|                                     | 10.1 - 12.5%                  |
|                                     | 12.5%+                        |

\*Note: Some items combined for display. See Unit Cost Table for specific unit costs for each type of obstruction, curb ramp, island curb cut. Missing sidewalk/gaps in connectivity reported together in compliance report and are separate in the GIS layers.  
\*\*Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.