




Access Compliance Report - Public Rights-of-Way
(Corridor: Sidewalk & Intersection Items)

Corridor ID: PATINA_LN_001



From: LODEN_PASS

To: N/A

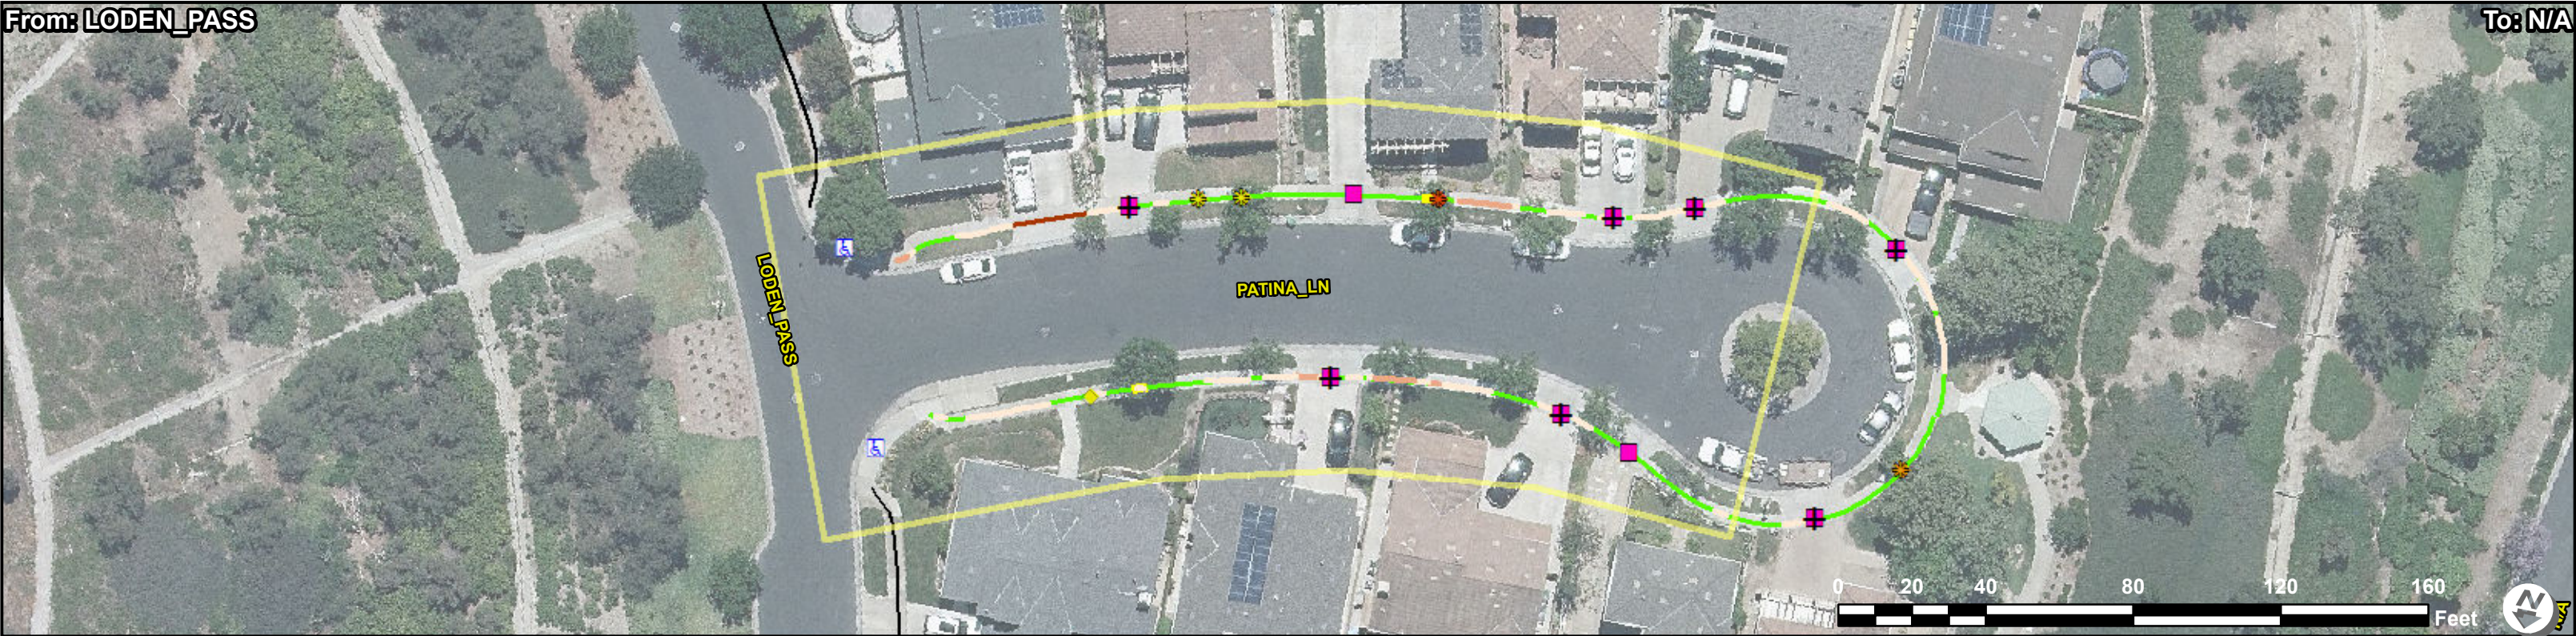

ADA Survey Summary

Item	Description	Quantity	
1	Vertical Displacement <= 1"	3	EA
2	Vertical Displacement > 1"	1	EA
3	Uneven Vertical Displacement	1	EA
4	Horizontal Opening > 0.5"	0	EA
5	Poor Surface Condition	3	SY
6	Utility Obstruction	0	EA
7	Power Pole Obstruction	0	EA
8	Traffic Signal Obstruction	0	EA
9	Sign Obstruction	0	EA
10	Low Vegetative Obstruction	0	EA
11	Overhead Vegetative Obstruction	0	EA
12	Other Obstruction*	0	EA
13	Miscellaneous Obstruction	0	EA
14	Temp/Private Obstruction	0	EA
15	Commercial Driveway	0	LF
16	Residential Driveway	131	LF
17	Total Sidewalk Length Assessed	600	LF
18	Average Sidewalk Width	48	IN
19	Curb Ramps In Corridor	0	EA
20	Island Curb Cuts In Corridor	0	EA
21	Signal Push Buttons In Corridor	0	EA
22	Accessible Parking Spaces In Corridor	0	EA
23	Missing Sidewalk/Gaps in Connectivity	0	LF
24	Buried/Narrow Sidewalk	0	LF
25	Sidewalk Not Surveyed	21	LF
26	No Sidewalk Observed	0	LF
27	Corridor Severity Score	15.09	

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54230276,-117.64301492

ADA Compliance Cost Estimate **

Item	Description	Quantity	Unit	Unit Price	Item Cost
1	Vertical Displacement <= 1"	2	EA	\$150.00	\$ 300.00
2	Vertical Displacement > 1"	1	EA	\$2125.00	\$ 2125.00
3	Uneven Vertical Displacement	1	EA	\$2125.00	\$ 2125.00
4	Horizontal Opening > 0.5"	0	EA	\$1062.00	\$ 0.00
5	Poor Surface Condition	3	SY	\$255.50	\$ 783.00
6	Utility Obstruction	0	EA	\$5000.00	\$ 0.00
7	Power Pole Obstruction	0	EA	\$20000.00	\$ 0.00
8	Traffic Signal Obstruction	0	EA	\$5000.00	\$ 0.00
9	Sign Obstruction	0	EA	\$2000.00	\$ 0.00
10	Low Vegetative Obstruction	0	EA	\$200.00	\$ 0.00
11	Overhead Vegetative Obstruction	0	EA	\$400.00	\$ 0.00
12	Other Obstruction*	0	EA	\$2000.00	\$ 0.00
13	Miscellaneous Obstruction	0	EA	\$2000.00	\$ 0.00
14	Commercial Driveway	0	LF	\$118.00	\$ 0.00
15	Residential Driveway	106	LF	\$118.00	\$ 12568.00
16	Running Slope Violation	0	SY	\$255.50	\$ 0.00
17	Cross Slope Violation	84	SY	\$255.50	\$ 21598.00
18	Running and Cross Slope violations	0	SY	\$255.50	\$ 0.00
19	Non-Compliant Curb Ramps and Total Cost*	0	EA	VARIES	\$ 0.00
20	Non-Compliant Island Curb Cuts and Total Cost*	0	EA	VARIES	\$ 0.00
21	Non-Compliant Signal Push Buttons Cuts and Total Cost*	0	EA	VARIES	\$ 0.00
22	Non-Compliant Accessible Parking Spaces and Total Cost*	0	EA	VARIES	\$ 0.00
23	Missing Sidewalk/Gap in Connectivity	0	SY	\$150.00	\$ 0.00
24	Buried/Narrow Sidewalk	0	SY	\$255.50	\$ 0.00
				Total:	\$ \$39,499.00

Compliance Symbolology	
	Compliant Curb Ramp
	Non-Compliant Curb Ramp
	Compliant Island Curb Cut
	Non-Compliant Island Curb Cut
	Compliant Signal
	Non-Compliant Signal
Cross Slope	
	2.01 - 3.0%
	3.01 - 4.0%
	4.01 - 5.0%
	5.01%+
Running Slope (Deviated, Costed)	
	5.1 - 8.3%
	8.4 - 10.0%
	10.1 - 12.5%
	12.5%+

*Note: Some items combined for display. See Unit Cost Table for specific unit costs for each type of obstruction, curb ramp, island curb cut. Missing sidewalk/gaps in connectivity reported together in compliance report and are separate in the GIS layers.
**Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.