




Access Compliance Report - Public Rights-of-Way
(Corridor: Sidewalk & Intersection Items)

Corridor ID: PIEDMONT_AVE_003

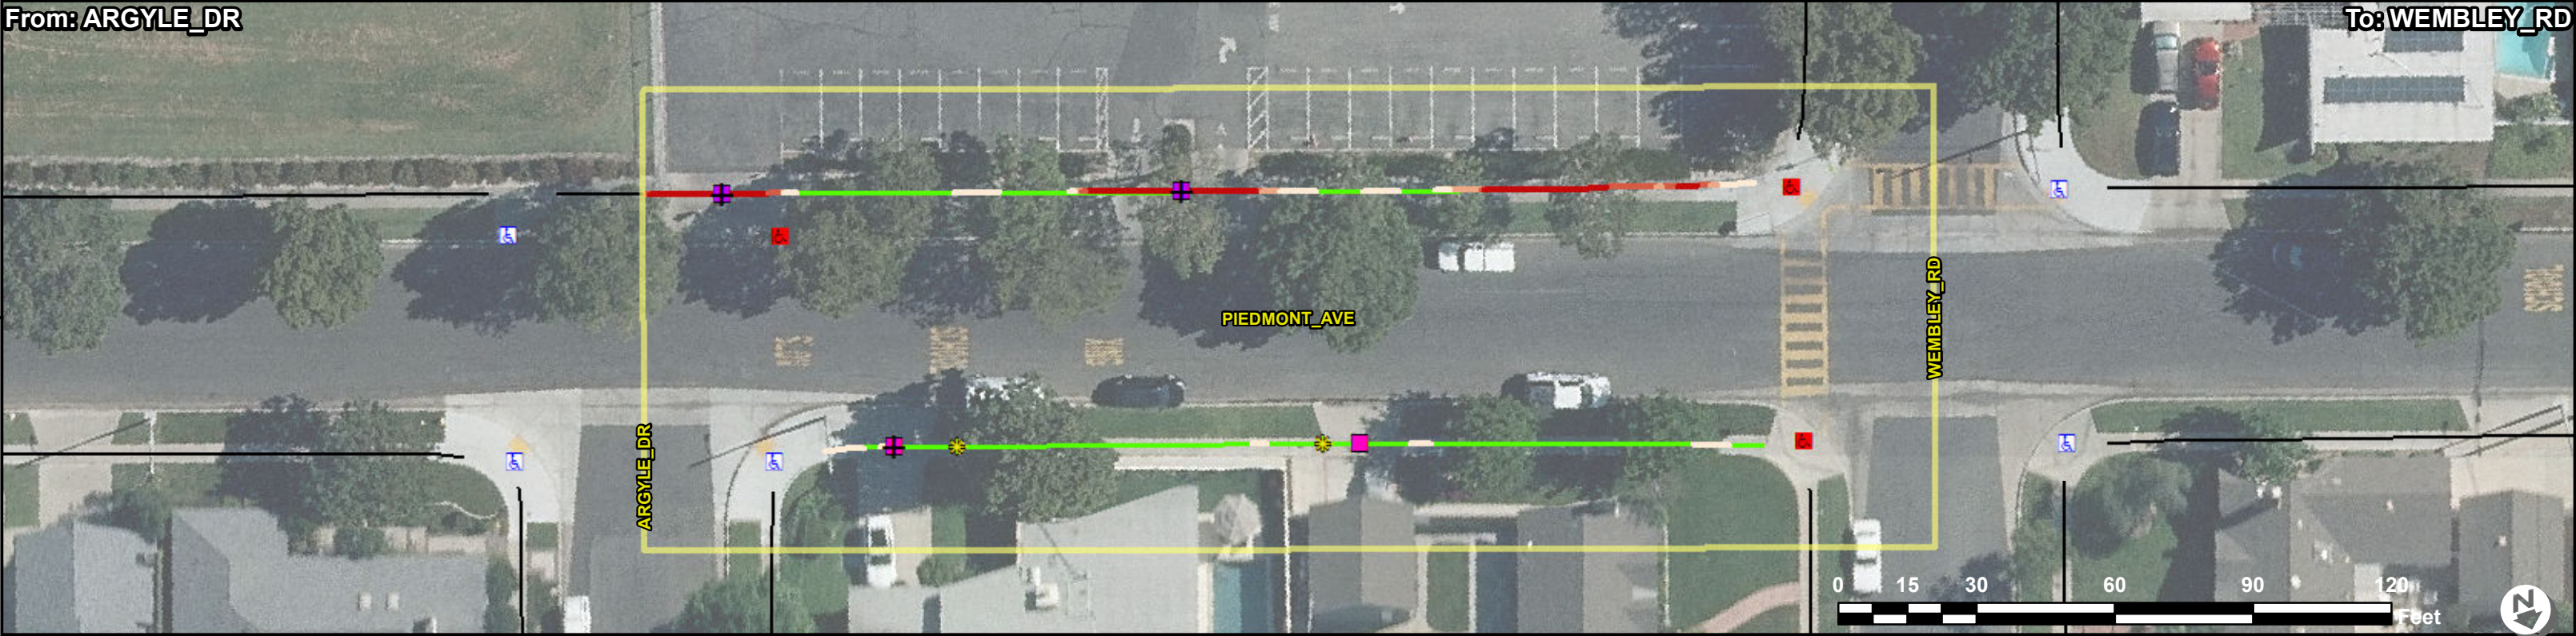

ADA Survey Summary

Item	Description	Quantity
1	Vertical Displacement <= 1"	2 EA
2	Vertical Displacement > 1"	0 EA
3	Uneven Vertical Displacement	0 EA
4	Horizontal Opening > 0.5"	0 EA
5	Poor Surface Condition	0 SY
6	Utility Obstruction	0 EA
7	Power Pole Obstruction	0 EA
8	Traffic Signal Obstruction	0 EA
9	Sign Obstruction	0 EA
10	Low Vegetative Obstruction	0 EA
11	Overhead Vegetative Obstruction	0 EA
12	Other Obstruction*	0 EA
13	Miscellaneous Obstruction	0 EA
14	Temp/Private Obstruction	0 EA
15	Commercial Driveway	54 LF
16	Residential Driveway	30 LF
17	Total Sidewalk Length Assessed	444 LF
18	Average Sidewalk Width	48 IN
19	Curb Ramps In Corridor	3 EA
20	Island Curb Cuts In Corridor	0 EA
21	Signal Push Buttons In Corridor	0 EA
22	Accessible Parking Spaces In Corridor	0 EA
23	Missing Sidewalk/Gaps in Connectivity	0 LF
24	Buried/Narrow Sidewalk	0 LF
25	Sidewalk Not Surveyed	0 LF
26	No Sidewalk Observed	0 LF
27	Corridor Severity Score	102.53

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79129411,-118.08508699

Inventory Symbology
Running Slope (Aligned, Not Costed)
5.1 – 8.3%
8.4 – 10.0%
10.1 – 12.5%
12.5%+
Collection in Adjacent Corridors
Curb Ramps
Island Curb Cuts
Signal Push Buttons
Sidewalk Collection

ADA Compliance Cost Estimate **

Item	Description	Quantity	Unit	Unit Price	Item Cost
1	Vertical Displacement <= 1"	2 EA	\$150.00	\$	300.00
2	Vertical Displacement > 1"	0 EA	\$2125.00	\$	0.00
3	Uneven Vertical Displacement	0 EA	\$2125.00	\$	0.00
4	Horizontal Opening > 0.5"	0 EA	\$1062.00	\$	0.00
5	Poor Surface Condition	0 SY	\$255.50	\$	0.00
6	Utility Obstruction	0 EA	\$5000.00	\$	0.00
7	Power Pole Obstruction	0 EA	\$20000.00	\$	0.00
8	Traffic Signal Obstruction	0 EA	\$5000.00	\$	0.00
9	Sign Obstruction	0 EA	\$2000.00	\$	0.00
10	Low Vegetative Obstruction	0 EA	\$200.00	\$	0.00
11	Overhead Vegetative Obstruction	0 EA	\$400.00	\$	0.00
12	Other Obstruction*	0 EA	\$2000.00	\$	0.00
13	Miscellaneous Obstruction	0 EA	\$2000.00	\$	0.00
14	Commercial Driveway	54 LF	\$118.00	\$	6392.00
15	Residential Driveway	14 LF	\$118.00	\$	1720.00
16	Running Slope Violation	0 SY	\$255.50	\$	0.00
17	Cross Slope Violation	63 SY	\$255.50	\$	16311.00
18	Running and Cross Slope violations	0 SY	\$255.50	\$	0.00
19	Non-Compliant Curb Ramps and Total Cost*	3 EA	VARIES	\$	9771.00
20	Non-Compliant Island Curb Cuts and Total Cost*	0 EA	VARIES	\$	0.00
21	Non-Compliant Signal Push Buttons Cuts and Total Cost*	0 EA	VARIES	\$	0.00
22	Non-Compliant Accessible Parking Spaces and Total Cost*	0 EA	VARIES	\$	0.00
23	Missing Sidewalk/Gap in Connectivity	0 SY	\$150.00	\$	0.00
24	Buried/Narrow Sidewalk	0 SY	\$255.50	\$	0.00

Total: \$ \$34,494.00

Compliance Symbology
Compliant Curb Ramp
Non-Compliant Curb Ramp
Compliant Island Curb Cut
Non-Compliant Island Curb Cut
Compliant Signal
Non-Compliant Signal
Cross Slope
2.01 - 3.0%
3.01 - 4.0%
4.01 - 5.0%
5.01%+
Running Slope (Deviated, Costed)
5.1 – 8.3%
8.4 – 10.0%
10.1 – 12.5%
12.5%+

*Note: Some items combined for display. See Unit Cost Table for specific unit costs for each type of obstruction, curb ramp, island curb cut. Missing sidewalk/gaps in connectivity reported together in compliance report and are separate in the GIS layers.
**Note: ADA pedestrian issues have been identified and quantified in the ADA Survey Summary. There are instances where multiple issues can be resolved with a single corrective measure. The ADA Compliance Cost Estimate reflects the best estimation of quantities and cost to resolve all identified ADA issues.