




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: ESENCIA_DR Cross Street: ESENCIA_DR Location: W

ADA ID: CCAT220208104214 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 6.25

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

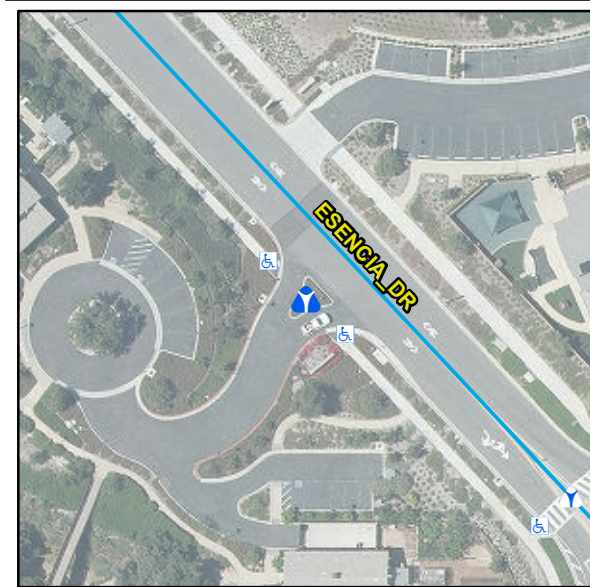

Possible Solutions:
Remove & Replace Entire Refuge.

Surveyor Notes:
N/A

OC Std/PROW:
R302.3.1, STD 1115

Total Cost: \$ **5000**

Parcel ID Number **755-301-29**

Google Street View Link
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53435959,-117.601899

Street 1 Name **ESENCIA_DR**
Stop Condition-Street 1 **N/A**
Street 2 Name **ESENCIA_DR**
Stop Condition-Street 2 **N/A**

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	60	N/A	Guttter 1 Ponding	N/A
No	Refuge 1 Width (In)	58	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	2.25	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 Cross Slope (%)	1.5	N/A	Gutter 1 Cross Slope (%)	N/A
N/A	Painted Cross Walk 1	No	N/A	DWS 1 Provided	N/A
	Cross Walk 1 Direction	N	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	N/A	N/A	DWS 1 Length (In)	N/A
N/A	Refuge Inside Cross Walk 1	N/A	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	3.39	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	0.8			N/A
Yes	Refuge 2 Length (In)	60	N/A	Guttter 2 Ponding	N/A
No	Refuge 2 Width (In)	58	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	1.38	N/A	Gutter 2 Slope (%)	N/A
Yes	Refuge 2 Cross Slope (%)	0.3	N/A	Gutter 2 Cross Slope (%)	N/A
N/A	Painted Cross Walk 2	No	N/A	DWS 2 Provided	N/A
	Cross Walk 2 Direction	S	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	N/A	N/A	DWS 2 Length (In)	N/A
N/A	Refuge Inside Cross Walk 2	N/A	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	2.34	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.2			
Yes	Overall Surface Condition: Acceptable				

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

