




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: O_NEILL_DR		Cross Street: CROWN_VALLEY_PKWY		Location:	SW
ADA ID: CCRK211102122241	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	40
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

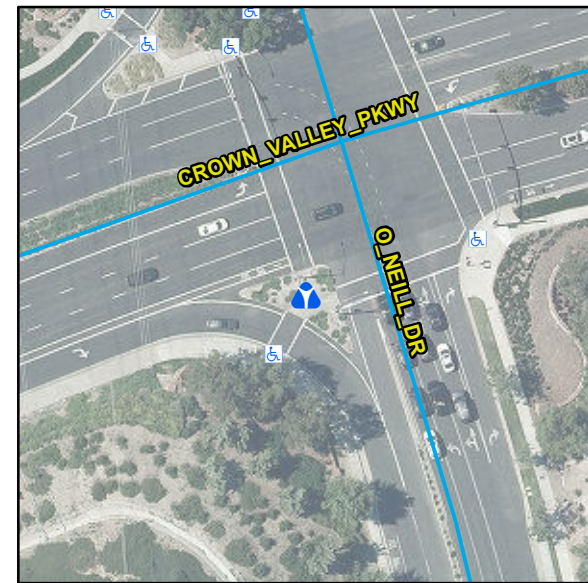

Possible Solutions:

Remove & Replace Entire Refuge. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R302.6, STD 1115

Total Cost: \$ 5000

Parcel ID Number 759-351-27

Street 1 Name O_NEILL_DR

Stop Condition-Street 1 N/A

Street 2 Name CROWN_VALLEY_PKWY


Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56507423,-117.64363501

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Traffic Signal Pole, Push Button	

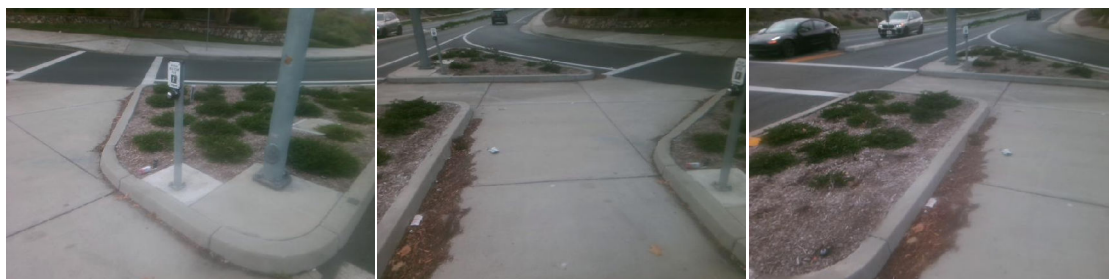

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	110	N/A	Guttter 1 Ponding	N/A
Yes	Refuge 1 Width (In)	92	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	5	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 Cross Slope (%)	0.4	N/A	Gutter 1 Cross Slope (%)	N/A
N/A	Painted Cross Walk 1	Yes	N/A	DWS 1 Provided	N/A
	Cross Walk 1 Direction	E	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	7	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1.4			
Yes	Refuge 2 Length (In)	192	N/A	Guttter 2 Ponding	N/A
Yes	Refuge 2 Width (In)	92	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	1.5	N/A	Gutter 2 Slope (%)	N/A
No	Refuge 2 Cross Slope (%)	6.2	N/A	Gutter 2 Cross Slope (%)	N/A
N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A
	Cross Walk 2 Direction	N	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	0.7	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	4.8			
Yes	Refuge 3 Length (In)		N/A	Guttter 3 Ponding	N/A
Yes	Refuge 3 Width (In)	92	Yes	Gutter 3 Lip Ht (In)	0
Yes	Refuge 3 Slope (%)	4.3	N/A	Gutter 3 Slope (%)	N/A
Yes	Refuge 3 Cross Slope (%)	3	N/A	Gutter 3 Cross Slope (%)	N/A
N/A	Painted Cross Walk 3	Yes	N/A	DWS 3 Provided	N/A
	Cross Walk 3 Direction	SW	N/A	DWS 3 Contrast	N/A
N/A	Cross Walk 3 Width (In)	144	N/A	DWS 3 Length (In)	N/A
Yes	Refuge Inside Cross Walk 3	Yes	N/A	DWS 3 Full Width	N/A
	Road 3 Slope (%)	0.9	N/A	DWS 3 Offset (In)	N/A
	Road 3 Cross Slope (%)	3.1			
Yes	Overall Surface Condition:	Acceptable			