




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: NARROW_CANYON_RD		Cross Street: NARROW_CANYON_RD		Location:	W
ADA ID: CCRK211103162636	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

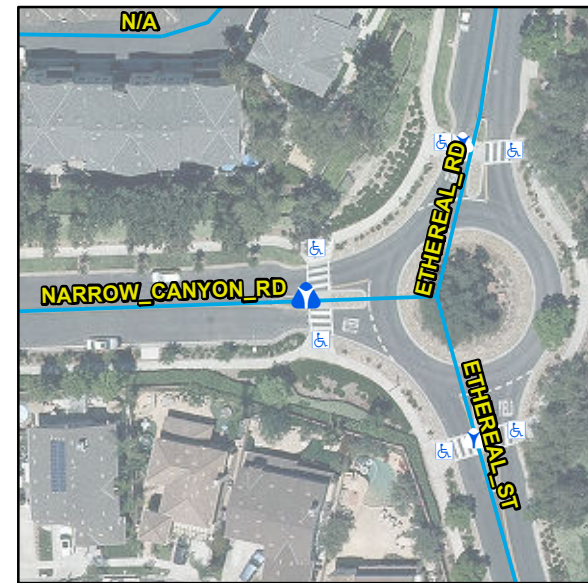

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.3, STD 1115

Total Cost: \$ 1452

Parcel ID Number 741-284-11

Street 1 Name NARROW_CANYON_RD

Stop Condition-Street 1 N/A

Street 2 Name NARROW_CANYON_RD

Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.5376491,-117.64383444

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	56	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	0.8	Yes	Gutter 1 Slope (%)	0.5
Yes	Refuge 1 Cross Slope (%)	1.9	No	Gutter 1 Cross Slope (%)	2.4
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No
	Cross Walk 1 Direction	N	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	145	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	2.2	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1.3			N/A
Yes	Refuge 2 Length (In)	56	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	2	Yes	Gutter 2 Slope (%)	1.2
Yes	Refuge 2 Cross Slope (%)	2	Yes	Gutter 2 Cross Slope (%)	0.8
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No
	Cross Walk 2 Direction	S	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	2.1	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.9			
Yes	Overall Surface Condition: Acceptable				

