




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: ETHEREAL_RD		Cross Street: ETHEREAL_RD		Location:	S
ADA ID: CCRK211104132719	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

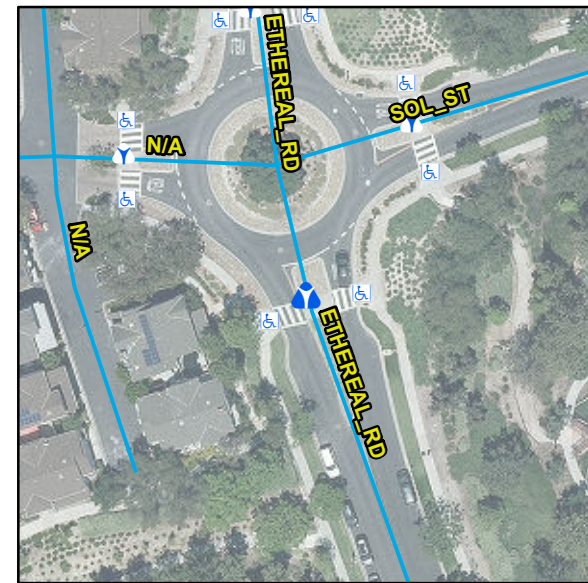

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.3, STD 1115

Total Cost:

\$ 1452

Parcel ID Number

741-274-25

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54112852,-117.64417125

Street 1 Name

ETHEREAL_RD

Stop Condition-Street 1

N/A

Street 2 Name

ETHEREAL_RD

Stop Condition-Street 2

N/A

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	102	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	0	Yes	Gutter 1 Slope (%)	0.5
Yes	Refuge 1 Cross Slope (%)	2	Yes	Gutter 1 Cross Slope (%)	2
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No
	Cross Walk 1 Direction	E	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	5.1	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	2.7			N/A
Yes	Refuge 2 Length (In)	104	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	1.6	Yes	Gutter 2 Slope (%)	0.5
Yes	Refuge 2 Cross Slope (%)	2.6	No	Gutter 2 Cross Slope (%)	2.8
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No
	Cross Walk 2 Direction	W	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	4	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.5			
Yes	Overall Surface Condition: Acceptable				

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

