




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: SIENNA_PKWY		Cross Street: SIENNA_PKWY		Location:	NE
ADA ID: CCRK211109125148	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--

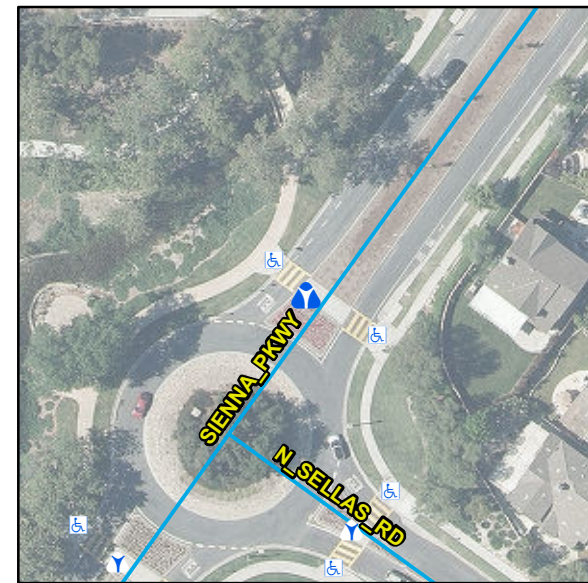

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.4, STD 1115

Total Cost: \$ 1452

Parcel ID Number 759-681-35

Street 1 Name SIENNA_PKWY

Stop Condition-Street 1 N/A

Street 2 Name SIENNA_PKWY

Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55529616,-117.63693642

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	168	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	3.6	No	Gutter 1 Slope (%)	6.6
Yes	Refuge 1 Cross Slope (%)	0.5	Yes	Gutter 1 Cross Slope (%)	0.8
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No
	Cross Walk 1 Direction	SE	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	2	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	0.1			N/A
Yes	Refuge 2 Length (In)	176	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	2.8	Yes	Gutter 2 Slope (%)	2.3
Yes	Refuge 2 Cross Slope (%)	0.7	Yes	Gutter 2 Cross Slope (%)	0.9
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No
	Cross Walk 2 Direction	NW	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	1	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.1			
Yes	Overall Surface Condition: Acceptable				

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

