




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: SIENNA_PKWY		Cross Street: SIENNA_PKWY		Location:	N
ADA ID: CCRK211110130303	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

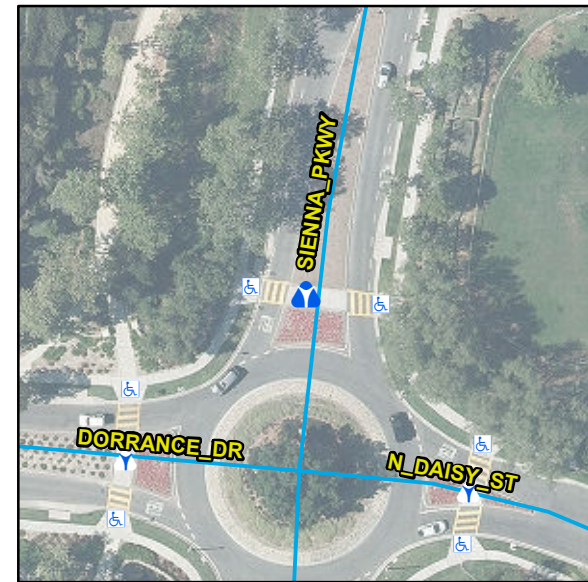

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.3, STD 1115

Total Cost:

\$ 1452

Parcel ID Number

759-601-14

Street 1 Name

SIENNA_PKWY

Stop Condition-Street 1

N/A

Street 2 Name

SIENNA_PKWY

Stop Condition-Street 2

N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55233724,-117.63843706

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	107	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	4.6	Yes	Gutter 1 Slope (%)	3.2
Yes	Refuge 1 Cross Slope (%)	0.4	Yes	Gutter 1 Cross Slope (%)	0.5
N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No
	Cross Walk 1 Direction	E	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	2.3	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1.6			N/A
Yes	Refuge 2 Length (In)	111	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	2.4	Yes	Gutter 2 Slope (%)	2.2
Yes	Refuge 2 Cross Slope (%)	3.5	No	Gutter 2 Cross Slope (%)	2.6
N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No
	Cross Walk 2 Direction	W	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	1.8	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.5			
Yes	Overall Surface Condition: Acceptable				

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

