




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: SIENNA_PKWY Cross Street: SIENNA_PKWY Location: SW

ADA ID: CCRK211111124659 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

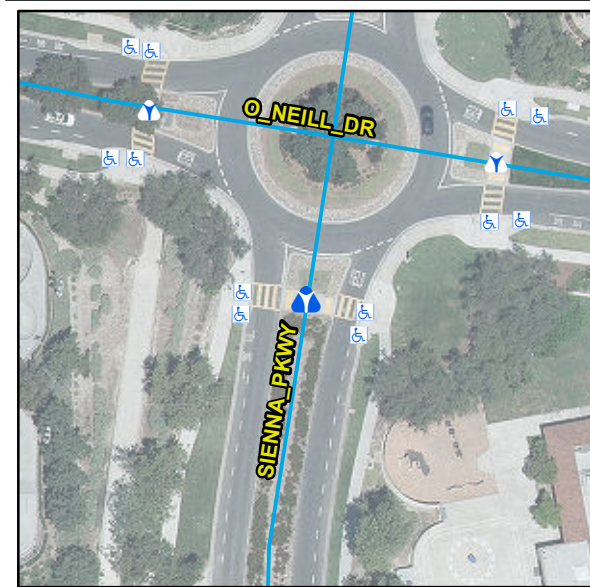

Possible Solutions:
**Remove & Replace Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:
N/A

OC Std/PROW:
R305.2, R304.5.3, STD 1115

Total Cost: \$ 2104

Parcel ID Number 741-072-02

Google Street View Link
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54482971,-117.64048081

Street 1 Name SIENNA_PKWY

Stop Condition-Street 1 N/A

Street 2 Name SIENNA_PKWY

Stop Condition-Street 2 N/A

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	107	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	1.9	Yes	Gutter 1 Slope (%)	1.9
Yes	Refuge 1 Cross Slope (%)	1.9	No	Gutter 1 Cross Slope (%)	3.9
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	SE	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	Yes	DWS 1 Full Width	Yes
	Road 1 Slope (%)	4.5	No	DWS 1 Offset (In)	24
	Road 1 Cross Slope (%)	2.9			N/A
Yes	Refuge 2 Length (In)	171	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	1	Yes	Gutter 2 Slope (%)	1.2
Yes	Refuge 2 Cross Slope (%)	1.8	No	Gutter 2 Cross Slope (%)	2.5
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	NW	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes
	Road 2 Slope (%)	0.7	No	DWS 2 Offset (In)	24
	Road 2 Cross Slope (%)	3.6			
Yes	Overall Surface Condition:	Acceptable			

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

