




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: SIENNA_PKWY		Cross Street: SIENNA_PKWY		Location:	NE
ADA ID: CCRK211111130501	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	7.5
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

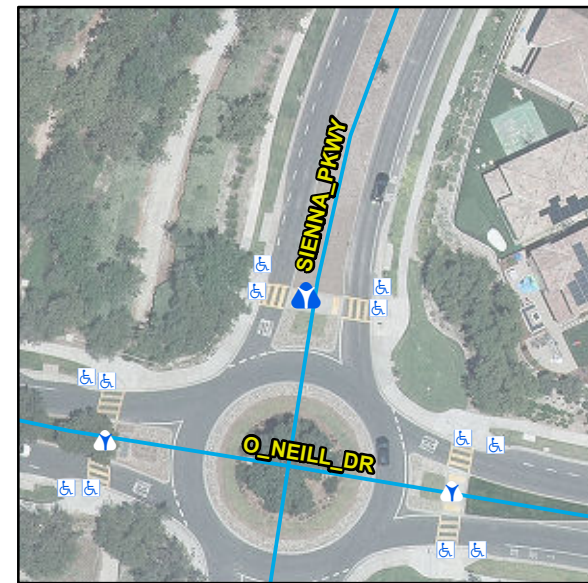

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

OC Std/PROW:

R305.1.4, R305.2, STD 1115

Total Cost: \$ 1600

Parcel ID Number 741-071-06

Street 1 Name SIENNA_PKWY

Stop Condition-Street 1 N/A

Street 2 Name SIENNA_PKWY


Stop Condition-Street 2 N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54530743,-117.64041281

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

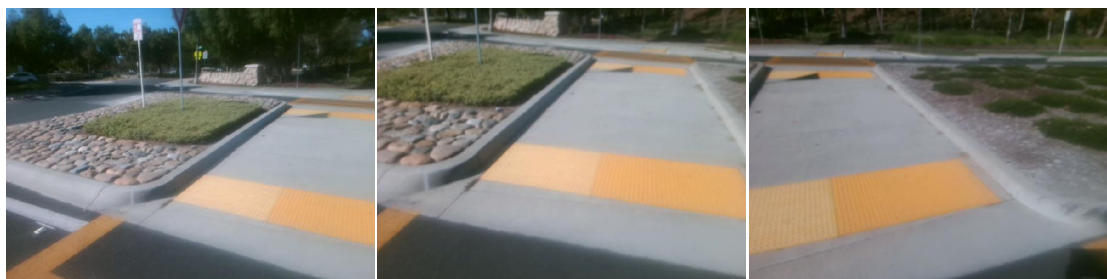

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	120	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	0.8	Yes	Gutter 1 Slope (%)	1.1
Yes	Refuge 1 Cross Slope (%)	1.8	Yes	Gutter 1 Cross Slope (%)	2.2
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	SE	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	No	DWS 1 Full Width	No
	Road 1 Slope (%)	4.2	No	DWS 1 Offset (In)	27
	Road 1 Cross Slope (%)	0.7			N/A
Yes	Refuge 2 Length (In)	117	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	4	Yes	Gutter 2 Slope (%)	1.1
Yes	Refuge 2 Cross Slope (%)	1.1	Yes	Gutter 2 Cross Slope (%)	1.3
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	NW	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	No	DWS 2 Full Width	No
	Road 2 Slope (%)	2.1	No	DWS 2 Offset (In)	38
	Road 2 Cross Slope (%)	2			
Yes	Overall Surface Condition:	Acceptable			