



# Access Compliance Report Public Rights-of-Way (Island Curb Cuts)




Main Street: O\_NEILL\_DR Cross Street: O\_NEILL\_DR Location: NW

ADA ID: CCRK211111131346 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 30

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

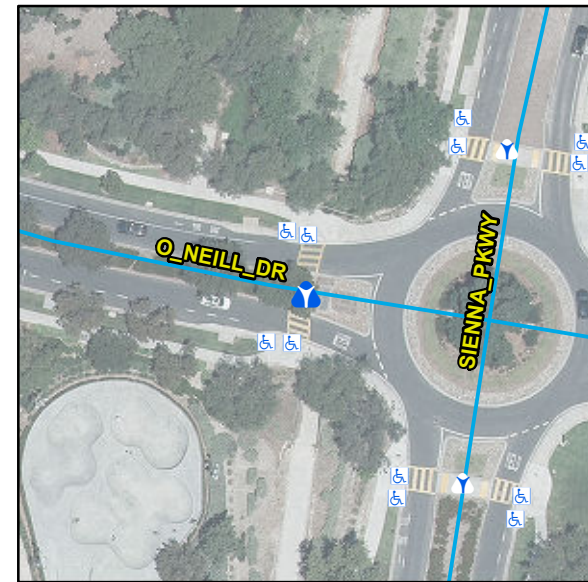

### Possible Solutions:

Remove & Replace Entire Refuge.

### Surveyor Notes:

N/A

### OC Std/PROW:

R302.5, STD 1115

### Total Cost:

\$ 5000

Parcel ID Number 741-072-02

Street 1 Name O\_NEILL\_DR

Stop Condition-Street 1 N/A

Street 2 Name O\_NEILL\_DR

Stop Condition-Street 2 N/A

Google Street View Link

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.54509689,-117.64075266](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54509689,-117.64075266)

| Compliance | Description                | Data       | Compliance | Description              | Data |
|------------|----------------------------|------------|------------|--------------------------|------|
| Yes        | Refuge 1 Length (In)       | 121        | N/A        | Guttter 1 Ponding        | N/A  |
| Yes        | Refuge 1 Width (In)        | 96         | Yes        | Gutter 1 Lip Ht (In)     | 0    |
| Yes        | Refuge 1 Slope (%)         | 1          | N/A        | Gutter 1 Slope (%)       | N/A  |
| Yes        | Refuge 1 Cross Slope (%)   | 1.8        | N/A        | Gutter 1 Cross Slope (%) | N/A  |
| N/A        | Painted Cross Walk 1       | Yes        | N/A        | DWS 1 Provided           | N/A  |
|            | Cross Walk 1 Direction     | NE         | N/A        | DWS 1 Contrast           | N/A  |
|            | Cross Walk 1 Width (In)    | 144        | N/A        | DWS 1 Length (In)        | N/A  |
| Yes        | Refuge Inside Cross Walk 1 | Yes        | N/A        | DWS 1 Full Width         | N/A  |
|            | Road 1 Slope (%)           | 0.8        | N/A        | DWS 1 Offset (In)        | N/A  |
|            | Road 1 Cross Slope (%)     | 0.2        |            |                          | N/A  |
| Yes        | Refuge 2 Length (In)       | 131        | N/A        | Guttter 2 Ponding        | N/A  |
| Yes        | Refuge 2 Width (In)        | 96         | Yes        | Gutter 2 Lip Ht (In)     | 0    |
| No         | Refuge 2 Slope (%)         | 10.1       | N/A        | Gutter 2 Slope (%)       | N/A  |
| Yes        | Refuge 2 Cross Slope (%)   | 3.2        | N/A        | Gutter 2 Cross Slope (%) | N/A  |
| N/A        | Painted Cross Walk 2       | Yes        | N/A        | DWS 2 Provided           | N/A  |
|            | Cross Walk 2 Direction     | SW         | N/A        | DWS 2 Contrast           | N/A  |
|            | Cross Walk 2 Width (In)    | 144        | N/A        | DWS 2 Length (In)        | N/A  |
| Yes        | Refuge Inside Cross Walk 2 | Yes        | N/A        | DWS 2 Full Width         | N/A  |
|            | Road 2 Slope (%)           | 3.3        | N/A        | DWS 2 Offset (In)        | N/A  |
|            | Road 2 Cross Slope (%)     | 4.1        |            |                          |      |
| Yes        | Overall Surface Condition: | Acceptable |            |                          |      |

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

