



Access Compliance Report Public Rights-of-Way (Island Curb Cuts)




Main Street: S_SELLAS_RD Cross Street: S_SELLAS_RD Location: SE

ADA ID: CCRK211111133940 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 30

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

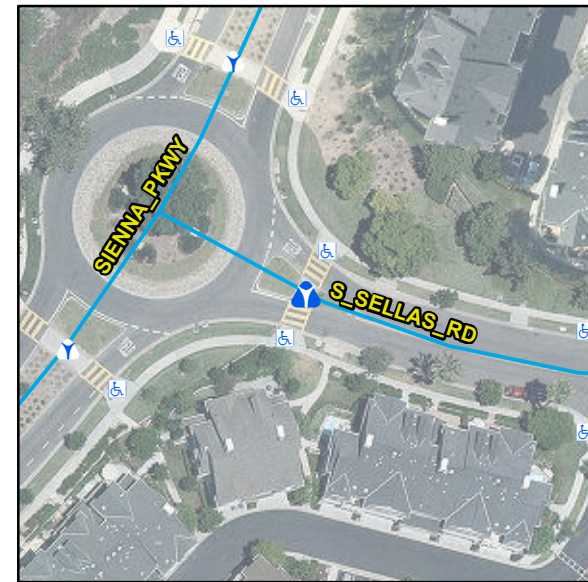

Possible Solutions:

Remove & Replace Entire Refuge.

Surveyor Notes:

N/A

OC Std/PROW:

R302.5, STD 1115

Total Cost:

\$ 5000

Parcel ID Number

759-531-30

Street 1 Name

S_SELLAS_RD

Stop Condition-Street 1

N/A

Street 2 Name

S_SELLAS_RD

Stop Condition-Street 2

N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54737801,-117.63776394

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	56	N/A	Guttter 1 Ponding	N/A
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
No	Refuge 1 Slope (%)	7.7	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 Cross Slope (%)	0.4	N/A	Gutter 1 Cross Slope (%)	N/A
N/A	Painted Cross Walk 1	Yes	N/A	DWS 1 Provided	N/A
	Cross Walk 1 Direction	NE	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	1	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	1			N/A
Yes	Refuge 2 Length (In)	56	N/A	Guttter 2 Ponding	N/A
Yes	Refuge 2 Width (In)	93	Yes	Gutter 2 Lip Ht (In)	0
No	Refuge 2 Slope (%)	6.9	N/A	Gutter 2 Slope (%)	N/A
Yes	Refuge 2 Cross Slope (%)	1.1	N/A	Gutter 2 Cross Slope (%)	N/A
N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A
	Cross Walk 2 Direction	SW	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	3.9	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	1.2			
Yes	Overall Surface Condition:	Acceptable			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

