

## **Access Compliance Report Public Rights-of-Way** (Island Curb Cuts)



Cross Street:O\_NEILL\_DR Main Street: O NEILL DR Location: W ADA ID: CCRK211115133232 Curb Cut Type: MedianRefuge2 **Initial Pass/Fail: Pass Overall Compliance: No Severity Score:** 15

**Codes/Mitigation Info/Possible Solution** 



Install Detectable Warning System.

Surveyor Notes:

N/A

OC Std/PROW:

R305, STD 1115

Total Cost:

1200

N/A

Parcel ID Number 759-201-82

Street 1 Name O\_NEILL\_DR Stop Condition-Street 1 Street 2 Name O\_NEILL\_DR


Google Street View Link Stop Condition-Street 2

N/A

http://www.google.com/maps/@?api=1&map\_action=pano&viewpoint=33.57067269,-117.63890924

Obstruction and Utility N	Measurement/Component	Compliance
---------------------------	-----------------------	------------

Compliance Description	Data Compliance Description	Data
Yes Obstructions Present?	No N/A Utilities Present?	No
Obstruction Types	N/A Utility Types	
Obstruction Dimensions	N/A	N/A

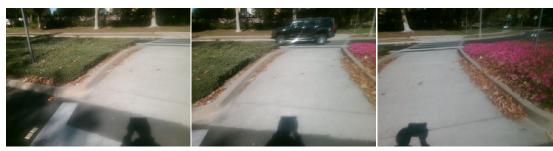

Field Measurements/Component Compliance									
1	Compliance Description		Data	a Compliance Description		Data			
	Yes	Refuge 1 Length (In)	166	Yes	Guttter 1 Ponding	No			
	Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0			
	Yes	Refuge 1 Slope (%)	4.3	Yes	Gutter 1 Slope (%)	4.7			
	Yes	Refuge 1 Cross Slope (%)	1.1	Yes	Gutter 1 Cross Slope (%)	1.1			
	N/A	Painted Cross Walk 1	Yes	No	DWS 1 Provided	No			
		Cross Walk 1 Direction	s	N/A	DWS 1 Contrast	N/A			
		Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A			
	Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A			
		Road 1 Slope (%)	2.8	N/A	DWS 1 Offset (In)	N/A			
		Road 1 Cross Slope (%)	1.7			N/A			
	Yes	Refuge 2 Length (In)	135	Yes	Guttter 2 Ponding	No			
	Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0			
	Yes	Refuge 2 Slope (%)	3.5	Yes	Gutter 2 Slope (%)	4.1			
	Yes	Refuge 2 Cross Slope (%)	2.1	Yes	Gutter 2 Cross Slope (%)	2			
	N/A	Painted Cross Walk 2	Yes	No	DWS 2 Provided	No			
		Cross Walk 2 Direction	N	N/A	DWS 2 Contrast	N/A			
2		Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A			
	Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A			
2		Road 2 Slope (%)	2	N/A	DWS 2 Offset (In)	N/A			
١.		Road 2 Cross Slope (%)	2.2						
	Yes	Overall Surface Condition: Acce	ptable						
				•					