


Access Compliance Report Public Rights-of-Way (Island Curb Cuts)

Main Street: COW_CAMP_RD **Cross Street:** ANTONIO_PKWY **Location:** S

ADA ID: CCRK211123130146 **Curb Cut Type:** IslandRefuge2 **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 15

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

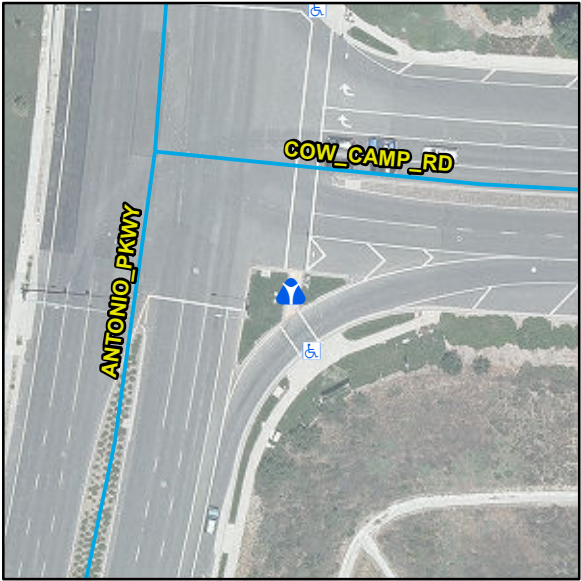

Possible Solutions:
Remove & Replace Entire Refuge.

Surveyor Notes:
N/A

OC Std/PROW:
R302.5, STD 1115

Total Cost: \$ **5000**

Parcel ID Number: 741-571-37

Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.52617153,-117.61850475

Street 1 Name: COW_CAMP_RD

Stop Condition-Street 1: N/A

Street 2 Name: ANTONIO_PKWY

Stop Condition-Street 2: N/A

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	184	N/A	Guttter 1 Ponding	N/A
Yes	Refuge 1 Width (In)	70	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	3.8	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 Cross Slope (%)	3.9	N/A	Gutter 1 Cross Slope (%)	N/A
N/A	Painted Cross Walk 1	Yes	N/A	DWS 1 Provided	N/A
	Cross Walk 1 Direction	NE	N/A	DWS 1 Contrast	N/A
	Cross Walk 1 Width (In)	144	N/A	DWS 1 Length (In)	N/A
Yes	Refuge Inside Cross Walk 1	Yes	N/A	DWS 1 Full Width	N/A
	Road 1 Slope (%)	4.2	N/A	DWS 1 Offset (In)	N/A
	Road 1 Cross Slope (%)	5.1			N/A
Yes	Refuge 2 Length (In)	120	N/A	Guttter 2 Ponding	N/A
Yes	Refuge 2 Width (In)	70	Yes	Gutter 2 Lip Ht (In)	0
No	Refuge 2 Slope (%)	6.7	N/A	Gutter 2 Slope (%)	N/A
Yes	Refuge 2 Cross Slope (%)	3.8	N/A	Gutter 2 Cross Slope (%)	N/A
N/A	Painted Cross Walk 2	Yes	N/A	DWS 2 Provided	N/A
	Cross Walk 2 Direction	S	N/A	DWS 2 Contrast	N/A
	Cross Walk 2 Width (In)	144	N/A	DWS 2 Length (In)	N/A
Yes	Refuge Inside Cross Walk 2	Yes	N/A	DWS 2 Full Width	N/A
	Road 2 Slope (%)	0.4	N/A	DWS 2 Offset (In)	N/A
	Road 2 Cross Slope (%)	3.6			
Yes	Overall Surface Condition:	Acceptable			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

