



Access Compliance Report Public Rights-of-Way (Island Curb Cuts)




Main Street: CHIQUITA_CANYON_DR Cross Street: CHIQUITA_CANYON_DR Location: NE

ADA ID: CCRK211124130933 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

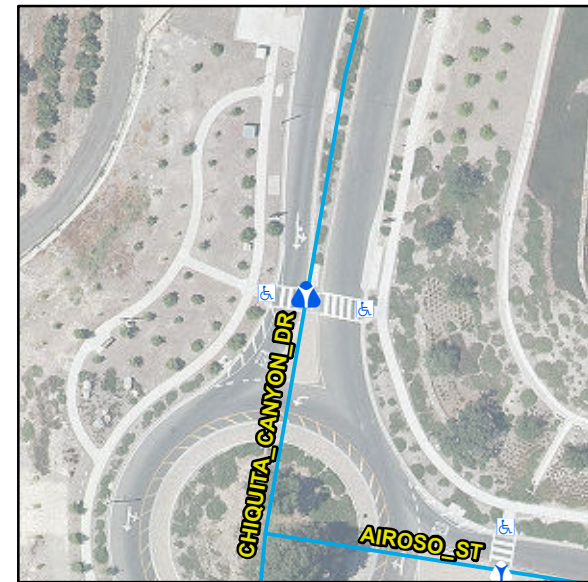

Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, STD 1115

Total Cost:

\$ 252

Parcel ID Number

755-301-16

Street 1 Name

CHIQUITA_CANYON_DR

Stop Condition-Street 1

N/A

Street 2 Name

CHIQUITA_CANYON_DR

Stop Condition-Street 2

N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53871806,-117.60828663

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	43	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	0.4	Yes	Gutter 1 Slope (%)	1.9
Yes	Refuge 1 Cross Slope (%)	1.2	Yes	Gutter 1 Cross Slope (%)	2
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	SE	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	Yes	DWS 1 Full Width	Yes
	Road 1 Slope (%)	0.1	Yes	DWS 1 Offset (In)	0
	Road 1 Cross Slope (%)	3			N/A
Yes	Refuge 2 Length (In)	43	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	0.3	Yes	Gutter 2 Slope (%)	1.3
Yes	Refuge 2 Cross Slope (%)	1.3	No	Gutter 2 Cross Slope (%)	3.3
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	NW	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes
	Road 2 Slope (%)	3.5	Yes	DWS 2 Offset (In)	0
	Road 2 Cross Slope (%)	3.9			
Yes	Overall Surface Condition:	Acceptable			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

